



U.S. Department of Transportation

National Highway Traffic Safety Administration

Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

*** *** ***



Case Vehicle (A): 1999 GMC

Type: Suburban SLT 4 x 4, 4-door SUV

Driver: 36-year-old female

CDC: 03-RFEW-4

SITUATION

(Slide 1) It was daytime and snowing, and (slide 2) the 2-lane asphalt road surface was slush covered and slippery, but free of defects. Case vehicle (A) was traveling south at a driverestimated speed of 72 kph (45 mph) in the southbound lane. (Slide 3) The driver of case vehicle (A) lost control of the vehicle, which veered to the left, went into a counterclockwise yaw, (slide 4) exited the east edge of the road surface, entered into a front yard, and (slide 5) struck a tree with its right side at the right-front fender. The driver of case vehicle (A) was taken to a regional level-1 trauma facility by ambulance and was hospitalized for one day. The right-front and right-rear passengers were taken to a regional level-1 trauma facility by ambulance and treated and released. The right-front passenger was later taken to his personal physician for a swollen ankle.

GENERAL VEHICLE DAMAGE AND ESTIMATED CRASH SEVERITIES

(Slide 6) The right-front fender of case vehicle (A) was severely crushed to the left, (slide 7) with the maximum crush of 73 cm at the center of the right fender. (Slide 8) Direct damage to case vehicle (A) began 50 cm to the rear of the right-front bumper corner and extended 56 cm further rearward.

Using the WinSMASH accident-reconstruction program and (slides 9, 10, 11 and 12) a crush profile measured for case vehicle (A), the following impact severity was calculated:

| | | Calculated V | Velocity Change | - kph (mph) |
|------------------|----------|--------------|-----------------|-------------|
| Vehicle | Variable | Total | Longitudinal | Latitudinal |
| Case Vehicle (A) | delta V | 35 (22) | -6 (-4) | -34 (-21) |

DESCRIPTION OF DAMAGE TO CASE VEHICLE (A)

Exterior

(Slide 13) On the right side, the upper and (slide 14) lower A- and B-pillars, roof siderail, and front door were damaged. (Slide 15) The right-front wheel was torn off. The front door was jammed closed but had been pried open by rescue personnel. (Slide 16) The rear door and quarter panel were slightly deformed and the right-side wheelbase was reduced 21 cm.

In the front, (slide 17) the hood, the right headlight assembly, the grille, and both hood hinges were damaged, and the right-front components were drawn rearward. The hood latch was damaged and jammed closed, but had been pried open by rescue or tow-yard personnel in order to disconnect the battery. (Slide 18) The rear edge of the hood was elevated, and it contacted, but did not penetrate, the damaged windshield. The bond was separated along the entire bottom edge of the windshield

On the left side, (slide 19) the fender was deformed, (slide 20) but there was no significant change in the wheelbase. (Slide 21) There was no damage to the rear of the vehicle.

Interior

This vehicle was equipped with steering-wheel and passenger frontal-impact airbags, and (slides 22 and 23) both deployed during this right-side impact. (Slides 24, 25, 26 and 27) There was no damage to the module flaps/covers of either the steering-wheel or (slides 28, 29, 30 and 31) passenger airbag modules. (Slides 32 and 33) There was no damage to the steering-wheel rim or (slides 34 and 35) spokes. (Slide 36) The steering column was rotated to the left but there was no apparent vertical rotation of the steering column. The following intrusions were noted and measured:

| Location | Component | Distance (cm) | Direction |
|-------------------------|---------------------|---------------|-----------|
| Driver (slides 37 & 38) | Transmission tunnel | 20 | to left |
| Right-front (slide 39) | Floor | 15 | up |
| (slide 40) | Instrument panel | 11 | to rear |
| (slide 41) | A-pillar | 10 | to left |
| | Door panel | 10 | to left |
| | A-pillar | 9 | to rear |
| | Door panel | 9 | to rear |

In addition, (slide 42) the gas pedal was bent upward and the brake pedal was bowed. (Slide 43) The trim of the upper, mid, and lower instrument panels, the upper vent outlets, and the control knobs were knocked loose by impact forces. (Slide 44) The left sunvisor was broken off. (Slide 45) The rearview mirror was broken. The center console was deflected to the left. (Slides 46 and 47) The climate control ducts were crushed by the displacement of the heater and airconditioning cores. In addition, the right-front door interior, right-front door armrest, right-front door hardware, right-front door window glass, (slide 48) right-roof siderail, and right B-pillar were damaged. (Slide 49) There was some dried blood on the lower right corner of the passenger-side frontal-impact airbag fabric. This blood was possibly from the right-rear passenger when he checked on the right-front passenger after the crash.

OCCUPANT KINEMATICS AND INJURIES

(Slide 50) The 5-ft, 6-in, 135-lb, 36-year-old female driver was <u>not</u> wearing the three-point belt, (slide 51) but the frontal-impact airbag deployed. (Slide 52) There were no witness marks on the plastic D-ring. On impact, the driver moved to the right and rearward relative to the vehicle interior, due to the rightward and counterclockwise rotational motion of the vehicle. (Slide 53) After the crash she was found on the floor of the vehicle behind the right-front seat. She sustained a right subdural hematoma with loss of consciousness, possibly from head contact with the center roof console (slides 54 and 55), as evidenced by a scuff mark. (Slide 56) She sustained bilateral pedicle fractures of C2, with a 2-mm anterior displacement of C2 over C3, due to flexion and compression of the neck, possibly from head contact with the floor and/or the right-side rear door. She sustained minor compression fractures of T5, T6, and T11 due to compressive loading of the spine, probably from the same head contact that resulted in the neck fractures.

She also sustained a contusion to the posterior region of her right shoulder, possibly from contact with the right-front seatback or from contact with the floor. She sustained contusions to her right and left buttocks, possibly from contact with the center console, (slides 57 and 58) as evidenced by a scuff mark, or possibly due to contact with the floor. She sustained contusions to her right and left knees, from unknown contacts. (Slide 59) She sustained an open fracture to the distal shaft of the right fibula, probably from contact with the transmission tunnel.

(Slide 60) The 4-ft, 0-in, 55-lb, 10-year-old male, right-front passenger has multiple birth defects including cerebral palsy. (Slide 61) He was restrained by a five-point harness in a "Tumble Form" positioning seat that was secured by the lap portion of the vehicle's three-point belt, and the passenger-side airbag deployed. (Slide 62) There were no witness marks on the plastic Dring, (slide 63) but the lap portion of the three-point belt was well worn. The top tether of the "Tumble Form" seat was not fastened. The right-front passenger sustained a hairline fracture to his left distal fibula, probably from leg contact with the glove box area, (slide 64) as evidenced by a scuff mark on the plastic cover.

(Slide 65) The 5-ft, 8-in, 130-lb, 15-year-old male, right-rear passenger was restrained by the three-point belt. (Slide 66) There were wear marks on the plastic D-ring, indicating general belt use, but there were no clear witness marks from occupant loading. He sustained multiple small lacerations to his face, neck, and both hands, due to flying broken glass. He sustained a small puncture wound to the left occipital region, probably due to flying broken glass.

The following tables and attached drawings (slides 67, 68 and 69) summarize the injuries sustained by the three occupants of case vehicle (A).

Occupant: Driver
Restraints: 3-point belt <u>not</u> worn; airbag deployed

Age: 36 years Stature: 168 cm (5 ft, 6 in)

Gender: Female Mass: 61 kg (135 lb)

| | | | Injury Source | | |
|---|--------|----------|---------------|---|--|
| Injury Description | A.I.S. | Definite | Probable | Possible | |
| Right subdural hematoma, with loss of consciousness | 4 | | | Center roof console | |
| Fractures, bilateral pedicles of C2 with 2-mm anterior displacement of C2 over C3 | 3 | | | Head contact with right- rear door/floor | |
| Contusion, posterior aspect of right shoulder | 1 | | , | Right-front seatback/floor | |
| Minor compression fractures, T5, T6 and T11 | 2 | | | Head contact with right- rear door/floor | |
| Contusion, right buttock | 1 | | | Center console/floor | |
| Contusion, left buttock | 1 | | | Center console/floor | |
| Open fracture, distal-shaft right fibula | 2 | | | Transmission tunnel | |
| Contusion, right knee | 1 | | | Unknown | |
| Contusion, left knee | 1 | | | Unknown | |
| | | | | | |
| Maximum A.I.S. Level | 4 | | | | |
| Injury Severity Score | 24 | | | | |
| | | | | | |

Occupant: Right front*

Restraints: In "Tumble Form" positioning seat with five-point

harness; Positioning seat secured by the vehicle

lap belt only; top tether not fastened; frontal-impact airbag deployed

Age: 10 years

Stature: 122 cm (4 ft, 0 in)

Gender: Male

Mass: 25 kg (55 lb)

| | | Injury Source | | |
|---------------------------------------|--------|---------------|-----------|----------|
| Injury Description | A.I.S. | Definite | Probable | Possible |
| Hairline fracture, distal left fibula | 2 | | Glove box | |
| | | | | |
| Maximum A.I.S. Level | 2 | | | |
| Injury Severity Score | 4 | | | |

^{*}This occupant has severe birth defects including cerebral palsy

Occupant: Right rear

Restraints: 3-point belt worn

Age: 15 years

Stature: 180 cm (5 ft, 8 in)

Gender: Male


Mass: 59 kg (130 lb)

| | | | Injury Source | |
|---|--------|----------|---------------|----------|
| Injury Description | A.I.S. | Definite | Probable | Possible |
| Small puncture wound, left occipital region | 1 | | Broken glass | |
| Small lacerations, face and neck | 1 | | Broken glass | i |
| Small lacerations, both hands | 1 | | Broken glass | |
| Maximum A.I.S. Level | 1 | | | |
| Injury Severity Score | 1 | | | |

| Duplicate columns 1-8 Module G Format from the previous card. | <u>0</u> <u>2</u> | GENERAL INFORMATION | GI-1 |
|---|-------------------|---|-------------|
| TIME DATE OF COLLISION | _ | ENVIRONMENTAL CONDITIONS CONSTRUCTION ZONE (0) NO (1) YES (9) UNKNOWN ROAD ALIGNMENT VERTICAL PLANE (1) LEVEL (2) CREST OF HILL (3) SLOPE (2%) (4) BOTTOM OF HILL (9) UNKNOWN ROAD ALIGNMENT HORIZONTAL PLANE (1) STRAIGHT (2) CURVE (3) T - SHAPED | 33 |
| (2) RURAL (9) UNKNOWN ENVIRONMENTAL CONDITIONS LIMITED-ACCESS HIGHWAY (0) NO (1) YES (9) UNKNOWN ROAD, TOTAL TRAFFIC LANES (FOR CASE VEHICLE) (1) 1-LANE (2) 2-LANES (3) 3-LANES (4) 4 OR MORE LANES (5) DIVIDED, 4 OR MORE LANES (6) PARKING LOT/DRIVEWAY (7) OTHER: (9) UNKNOWN | Q 28 28 29 | (4) Y - SHAPED (7) OTHER: (9) UNKNOWN SURFACE COVERING (10) DRY (21) WATER - DAMP (22) WATER - WET (23) WATER - PUDDLED (29) WATER - AMOUNT UNKNOWN (31) SNOW - LOOSE (32) SNOW - PACKED (39) SNOW - CONDITION UNKNOWN (41) ICE (51) SLUSH (61) SPILLED GRAVEL (71) OTHER: (99) UNKNOWN VISIBILITY LIMITATION | 5 1 37 |
| INTERSECTING RD, TOTAL LANES CHOOSE FROM ABOVE LIST, OR (8) NOT APPLICABLE TYPE OF ROAD SURFACE (1) ASPHALT (2) CONCRETE (3) GRAVEL (4) MORE THAN ONE (CIRCLE EACH) (7) OTHER: (9) UNKNOWN | 30 | (FOR CASE VEHICLE) (0) NONE (1) CLOUDY/DARK (2) FOG (3) SMOKE (4) WINDSHIELD CONDITION (5) GLARE (6) RAIN (7) OTHER: (8) ICE/SNOW (9) UNKNOWN VISIBILITY OBSTRUCTION (FOR CASE VEHICLE) (0) NONE | <u>O</u> 38 |
| ROAD DEFECTS (0) NO (1) YES (9) UNKNOWN | D _32- | (1) BUILDING (2) SIGN (3) VEGETATION (E.G. BUSHES, SHRUBS) (4) TREE (5) HILL OR CURVE IN ROAD (6) VEHICLE IN TRANSPORT (7) OTHER: (8) PARKED VEHICLE (9) UNKNOWN | 39 |

| | | GENERAL INFORMATION GI-2 |
|---|-------------------|--|
| ENVIRONMENTAL CONDITIONS SPEED LIMIT (0) 5-45 km/h 5-25 mph (1) 46-55 30 (2) 56-60 35 (3) 61-70 40 (4) 71-79 45 (5) 80-85 50 (6) 86-90 55 (7) 91-105 60 (8) OVER 105 65 (9) UNKNOWN | 6 | MECHANICAL MALFUNCTION WAS THERE MENTION OF A MECHANICAL MALFUNCTION IN CASE VEHICLE (0) NO (1) YES (2) YES, DID NOT CONTRIBUTE TO ACCIDENT (9) UNKNOWN |
| PRECIPITATION (0) NONE (1) RAIN (2) SNOW (3) HAIL (4) FREEZING RAIN/SLEET (7) OTHER: (9) UNKNOWN RATE OF PRECIPITATION (1) LIGHT/MIST (2) MODERATE (3) HEAVY (8) NOT APPLICABLE (9) UNKNOWN TEMPERATURE (0) BELOW -15° C BELOW 5° F (1) -15 TO -6 5 TO 22 (2) -5 TO -1 23 TO 31 (3) 0 TO 2 32 TO 36 (4) 3 TO 5 37 TO 41 (5) 6 TO 15 42 TO 59 (6) 16 TO 25 60 TO 77 (7) 26 TO 35 78 TO 95 (8) OVER 35 OVER 96 (9) UNKNOWN CROSSWIND (0) NONE (1) LIGHT (2) STRONG (3) GUSTY & STRONG (9) UNKNOWN LIGHT CONDITIONS (1) DAYLIGHT (2) DAWN (3) DUSK (4) DARK, LIGHTED (5) DARK, UNLIGHTED (6) DARK, UNKNOWN IF LIGHTED (9) UNKNOWN | 2 1 1 2 2 43 1 45 | THE FOLLOWING SECTION SHOULD BE FILLED OUT IF A MECHANICAL MALFUNCTION IS RECOGNIZED OR SUSPECTED. CIRCLE ITEMS INVOLVED. SUPPORT ANY ITEMS CIRCLED WITH COMMENTS. BRAKE SYSTEM DRIVER CONTROLS EXHAUST SYSTEM POWER TRAIN STEERING SYSTEM FUEL SYSTEM SUSPENSION SYSTEM VISIBILITY ITEMS ELECTRICAL SYSTEM TIRES THROTTLE CONTROLS UNKNOWN OTHER: COMMENTS: COMMENTS: |
| | | |

| | | GENERAL INFORMATION | GI-3 |
|---|-------------|---|-------------|
| CRASH DETAILS CASE VEHICLE AND OBJECT (0) NO (1) YES (9) UNKNOWN | 47 | HIGHEST POLICE INJURY SEVERITY CODE IN CRASH (NOT JUST CASE VEHICLE) (0) O - NO INJURY (1) C - POSSIBLE INJURY (2) B - NON-INCAPACITATING INJURY (3) A - INCAPACITATING INJURY | |
| CASE VEHICLE ROLLOVER (0) NO ROLLOVER (1) YES, FIRST EVENT (2) YES, SUBSEQUENT EVENT (3) YES, SEQUENCE UNKNOWN (9) UNKNOWN | <u>O</u> 48 | (4) K - FATAL (5) INJURED, SEVERITY UNKNOWN (6) DIED PRIOR TO ACCIDENT (7) NON-FATAL INJURY SEVERITY UNKNOWN (9) UNKNOWN | 3 |
| CASE VEHICLE RAN OFF ROADWAY (BEFORE FIRST IMPACT) (0) NO (1) YES (9) UNKNOWN | 1/49 | DRIVER IMPAIRMENT DRIVER ALCOHOL INVOLVEMENT (CASE VEHICLE) (0) NONE (1) YES (9) UNKNOWN/NOT REPORTED/ NO DRIVER | <u>O</u> 56 |
| MOVING CASE VEHICLE AND CONTACTED MOVING VEHICLE (0) NO (1) YES (9) UNKNOWN | <u>O</u> 50 | DRIVER ALCOHOL BAC (CASE VEHICLE) (80) NO TEST (90) CHEMICAL TESTS, NO RESULTS (95) AUTOPSY, NO RESULTS (99) UNKNOWN | <u>8</u> 6 |
| CASE VEHICLE AND CONTACTED STOPPED VEHICLE (0) NO (1) YES (9) UNKNOWN | <u>O</u> 51 | WAS THERE MENTION OF DRIVER IMPAIRMENT FOR CASE VEHICLE? (0) NO (1) YES (9) UNKNOWN | <u>O</u> 59 |
| STOPPED CASE VEHICLE AND CONTACTED VEHICLE (0) NO (1) YES (9) UNKNOWN | 52 | LIST IMPAIRMENTS MENTIONE | ED: |
| TOTAL NUMBER OF VEHICLES CONTACTED BY CASE VEHICLE IN CRASH (8) 8 OR MORE (9) UNKNOWN | <u>O</u> 53 | POST - CRASH DETAIL MANNER CASE VEHICLE LEFT SCENE | |
| ANY FIRE IN THIS CRASH (NOT JUST CASE VEHICLE) (0) NO (1) YES (9) UNKNOWN | <u>Ø</u> | (1) DRIVEN (2) TOWED DUE TO DAMAGE (3) TOWED, NOT DUE TO DAMAGE (4) TOWED, REASON UNKNOWN (9) UNKNOWN | 2 60 |

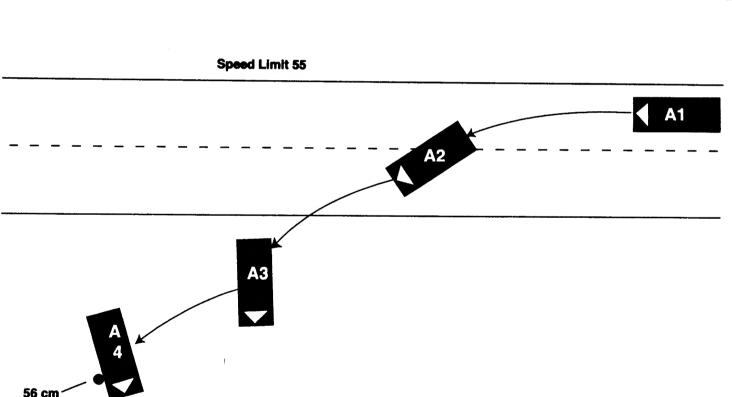

diameter tree

| Duplicate columns 1-8 Module O V Format 0 from the previous card. | - 4 | OTHER VEHICLE | OV-1 |
|---|--|--|-------|
| MAKE:NOT APPLICABLE | E | CARGO: | |
| VIN | | 29 | |
| MANUFAC/BODY CODE MAKE/MODEL CODE MODEL YEAR WEHICLE MASS (kg) 43 IF SEPARATE REPORT WAS MADE, GIVE VEHICLE NUMBER NUMBER OF OCCUPANTS (ENTER 9'S IF UNKNOWN) TRAVELING SPEED (km/h) (000) PARKED OR STOPPED | 34 PAS: (1) (2) (3) (42) (42) (43) (44) (45) (46) (47) (47) (47) (48) (49) (49) (49) (49) (49) (49) (49) (49 | SENGER VEHICLE D2) LARGE D3) LIMOUSINE D7) PICKUP CAR D80 UNKNOWN PASSENGER VEHICLE BODY D81 SUB-MINI D82 SUB-MINI D83 SUB-COMPACT D83 INTERMEDIATE D99) FULL D83 FULL D84 SMALL UTILITY (WHEELBASE MORE THAN 107', E.G. JEEP, BRONCO) D95 LARGE UTILITY (WHEELBASE MORE THAN 107', E.G. PANEL TRUCK, SUBURBAN) D96 PICKUP TRUCK WITH CANOPY/SHELL COVER D97 PICKUP CAR WITH CANOPY/SHELL COVER D97 PICKUP TRUCK WITH SUIDE-IN CAMPER D97 PICKUP CAR WITH CARPER D97 PICKUP CA | 56 57 |
| (995) JUST STARTING UP (996) BACKING UP (997) SPEED NOT EXCESSIVE (BUT UNKNOWN) (998) SPEED EXCESSIVE (BUT UNKNOWN) (999) UNKNOWN HIGHEST POLICE INJURY SEVERITY CODE FOR THIS VEHICLE (0) O - NO INJURY (1) C - POSSIBLE INJURY (2) B - NON-INCAPACITATING INJURY (3) A - INCAPACITATING INJURY (4) K - FATAL (5) INJURED, SEVERITY UNKNOWN (6) DIED PRIOR TO ACCIDENT (7) NON-FATAL INJURY SEVERITY UNKNOWN (8) UNOCCUPIED VEHICLE (NOT APPLICABLE) (9) UNKNOWN | (1) (1) (1) (1) (2) (3) (3) (3) (3) (3) (3) (3) (3) (3) (3 | 1) VAN 2) PICKUP TRUCK 3) UNKNOWN LIGHT TRUCK 5) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN) 6) PICKUP TRUCK WITH CANOPY/SHELL COVER 2) PICKUP TRUCK WITH SLIDE-IN CAMPER 0) UNKNOWN TRUCK TYPE 1) CHASSIS-MOUNTED CAMPER 3) DELIVERY VAN (WALK-IN) 4) STRAIGHT TRUCK 6) TRUCK-TRACTOR (BOBTAIL) 6) CHASSIS-CAB 7) UNKNOWN HEAVY TRUCK 8) TRACTOR & SEMI-TRAILER (SEMI) 9) TRUCK (OR SEMI) & FULL TRAILER(S) 1) UNKNOWN BUS TYPE 1) SCHOOL BUS 2) INTERCITY BUS (BETWEEN CITIES) 3) TRANSIT BUS (INTRACITY) 4) STREETCAR (ON TRACKS) 6) LOCOMOTIVE (ENGINE, SWITCHER) 10) UNKNOWN ELBASE (CT) 19) UNKNOWN | |

| Duplicate columns 1-8 from the previous card. | Module O V | Format <u>0</u> <u>2</u> | 0 | THER VEHICLE | OV-2 |
|---|--------------|---------------------------|-------------------------|--------------|------|
| | | ORIGINAL SPE | CIFICATIONS | | |
| Wheelbase | | cm | Front Overhang | 22 - 24 | cm |
| Curb Weight | | kg | Rear Overhang | 25 27 | cm |
| Average Track Width | | cm | Undeformed End Width (| UEW) | cm |
| Overall Length | 16 18 | cm | Engine Displacement | 31 32 | L |
| Overall Width (OAW) | 19 | cm | Engine: # of Cylinders | 33 34 | |
| | | VEHICLE | DAMAGE | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | NOT APPLIC | ABLE | | ÷. |
| | | | | | |
| | | | | | |
| | | | | | |
| | | -1 | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | | | | |
| | | FRONTAL CRA | | | |
| Round up for .5. 98 = nter % overlap or "99" fo | | | Direct Damage Length (D | DDL) | cm |
| | sairig Ur IV | V / 1. | | | |
| | • | | | | |
| | Overlap (Per | cent) = <u>DDL</u> UEW | | 38 39 | % |
| | | UEW | | 38 39 | % |

| Duplicate columns 1-8 Module V D Format 0 4 from the previous card. | VEHICLE DESCRIPTION | VD-1 |
|--|--|---------|
| MAKE: GMC MODEL: SUBURBAN SLT 4X4, 4 | CARGO: | |
| VIN 3 G K F K 1 6 | R7XG | 29 |
| MANUFAC/BODY CODE $\frac{9}{30} + 1 + \frac{5}{34}$ | STOLEN VEHICLE | |
| MAKE/MODEL CODE $\frac{3003}{38}$ | (0) NO (1) YES (8) NOT COLLECTED | 8 62 |
| MODEL YEAR $\frac{1}{9} \frac{9}{9} \frac{9}{9}$ | (9) UNKNOWN | |
| VEHICLE MASS (kg) $O = 2 $ $O = 3 $ $O = 48$ | BODY STRUCTURE | , |
| ODOMETER (km) (ENTER 9'S IF UNKNOWN) (ENTER 8'S IF ELECTRONIC) ODOMETER (km) 49 6 1 9 8 2 54 | (1) BODY & FRAME (2) UNITIZED (3) INTEGRAL-STUB FRAME (4) BODY & PLATFORM FRAME | 63 |
| NUMBER OF OCCUPANTS (ENTER 9'S IF UNKNOWN) (4st) (4st) | (E.G. VW BUG) (5) PARTIALLY UNITIZED (7) OTHER: (9) UNKNOWN | |
| TRAVELING SPEED (km/h) 0 7 2 | | |
| (000) PARKED OR STOPPED (995) JUST STARTING UP (996) BACKING UP (997) SPEED NOT EXCESSIVE (BUT UNKNOWN) (998) SPEED EXCESSIVE (BUT UNKNOWN) (999) UNKNOWN | TRANSMISSION (0) NONE (1) AUTOMATIC (2) MANUAL (9) UNKNOWN | J 64 |
| VEHICLE TYPE | | |
| PASSENGER VEHICLE (11) 2-DOOR HARDTOP (NO UPPER B-PILLAR) (12) 2-DOOR SEDAN OR COUPE (ANY UPPER B-PILLAR) (13) 4-DOOR HARDTOP (14) 4-DOOR SEDAN (15) STATION WAGON (16) CONVERTIBLE (18) OTHER PASS, VEH. : | LOCATION OF TRANSMISSION SELECTOR LEVER (1) FLOOR (2) CONSOLE (3) COLUMN (7) OTHER: (9) UNKNOWN | 3 65 |
| (19) PASSENGER VEHICLE, TYPE UNKNOWN MULTIPURPOSE PASSENGER VEHICLE (21) SMALL UTILITY (E.G. JEEP, SCOUT, BRONCO) (22) LARGE UTILITY (E.G. PANEL TRUCK SUBURBAN) (23) VAN, SIZE UNKNOWN (24) VAN, SMALL (MINI) (25) VAN, LARGE (29) MPV, TYPE UNKNOWN (30) MOTOR HOME | STEERING (1) POWER (2) MANUAL (9) UNKNOWN | 66 |
| TRUCK (31) PICKUP TRUCK, UNKNOWN (32) PICKUP TRUCK, SMALL (DOWNSIZED) (33) PICKUP TRUCK, LARGE (99) UNKNOWN | BRAKES (1) POWER (2) MANUAL (9) UNKNOWN | <u></u> |

| | · · · · · · · · · · · · · · · · · · · | VEHICLE DESCRIPTION VD-2 |
|---|---------------------------------------|--|
| TYPE OF BRAKES (1) DRUM, ALL WHEELS (2) DISC, FRONT WHEELS (3) DISC, ALL WHEELS (9) UNKNOWN | 2 68 | WHEELBASE (cm) (999) Unknown 3 3 76 77 |
| BRAKE ANTI-LOCK DEVICE (0) NONE INSTALLED (1) TWO-WHEEL (2) FOUR-WHEEL (7) EQUIPPED, UNKNOWN WHEELS (9) UNKNOWN AIR CONDITIONING IN VEHICLE (0) NO (1) YES (8) NOT COLLECTED (9) UNKNOWN | 2 69 70 | PLASTIC ANTI-LACERATIVE INNER LAYER GLASS EQUIPPED (0) NONE (1) WINDSHIELD (2) WINDSHIELD AND SIDE (7) OTHER (9) UNKNOWN |
| TYPE OF DRIVE (1) REAR WHEEL (2) FRONT WHEEL (3) FOUR WHEEL (4) ALL WHEEL DRIVE (9) UNKNOWN DUAL REAR WHEELS (0) NO (1) YES (9) UNKNOWN ORIGINAL TYPE OF RESTRAINT SYSTEM (1) ACTIVE BELT (2) PASSIVE BELT (3) AIRBAG (4) KNEE BOLSTERS (7) OTHER: (8) NOT APPLICABLE (NOT EQUIPPED) (9) UNKNOWN | 3 71 2 72 73 | FIELD INVESTIGATOR INSTRUCTIONS: 1. INDICATE CRUSHED AREAS BY OUT-LINING NEW PERIMETER OF VEHICLE AND SHADING THE DAMAGED AREAS ON THE LARGE SKETCH ON PAGE VD-3. USE AS MANY SKETCHES AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE. 2. ENTER THE DIMENSIONS ON THE SKETCH(ES) MEASURED TO THE POINT OF MAXIMUM PENETRATION BY THE OBJECT(S) CONTACTED. USE THE EXAMPLES BELOW AS A GUIDE. 3. ENTER THE THREE DIMENSIONS TO THE CENTER OF THE WHEELS (WHEELBASE, FRONT AND REAR OVERHANGS) ON BOTH SIDES OF THE CAR. 4. ADD OTHER DIMENSIONS AS NECESSARY TO COMPLETELY DESCRIBE THE DAMAGE. EXAMPLES: |
| (0) NO (1) YES (9) UNKNOWN TYPE OF ROOF (0) NONE (1) SOLID (2) T-TOP CLOSED (3) T-TOP OPEN (4) SUN ROOF CLOSED (5) SUN ROOF OPEN (6) CONVERTIBLE CLOSED (7) CONVERTIBLE OPEN (8) OTHER: (9) UNKNOWN | <u>O</u> 74 | ROOF (REFERENCE TO TOP OF DOOR SILL OR WINDOW SILL) |

Duplicate columns 1-8 from the previous card. Module V D Format 0 2 11 12

VEHICLE DESCRIPTION

VD-3

ORIGINAL SPECIFICATIONS

Wheelbase

Front Overhang

0 9 2 cm

2479 kg **Curb Weight**

Rear Overhang $\frac{1}{25} \frac{3}{25} \frac{4}{27} \text{ cm}$ Undeformed End Width (UEW) $\frac{1}{28} \frac{8}{27} \frac{0}{27} \text{ cm}$

Average Track Width $\frac{1}{13} \frac{6}{5} \frac{8}{15}$ cm


Overall Length $\frac{5}{16} \frac{5}{5} \frac{8}{18}$ cm

Engine Displacement

Overall Width (OAW) 1 9 5 cm

Engine: # of Cylinders

VEHICLE DAMAGE

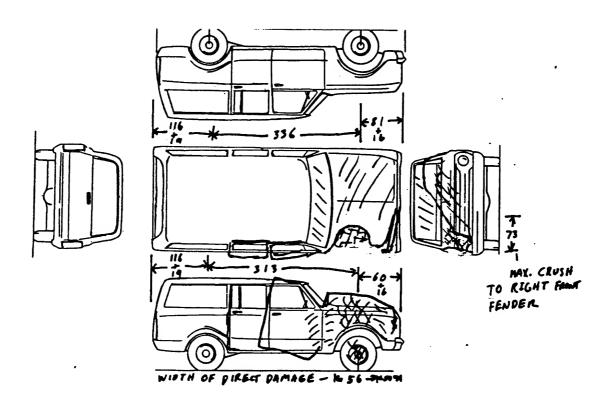

FRONTAL CRASH OVERLAP

Round up for .5. 98 = 98% or more Enter % overlap or "99" for missing or N/A.

Direct Damage Length (DDL) 9 9 7 cm

Front-End Overlap (Percent) = DDL UEW

Vehicle Overlap (Percent) = DDL + 1/2 (OAW - UEW)

9 9%

| | A Format 0 2 | DAMAGE DA-1 |
|------------------------------------|---|---|
| PRIMARY | CASE VEHICLE PRIMARY CDC | CONTACTED VEHICLE ASSOCIATED CDC |
| EVENT NUMBER | | Tree |
| IMPACT SPEED (km/h) | 9 9 9 | $\frac{9}{35} \frac{9}{36} \frac{8}{37}$ |
| ESTIMATED BY | <u> </u> | 8 38 |
| CRUSH (cm) | <u>O</u> 7 3 18 19 20 | 9 9 8 |
| CDC #1 | 03.R FEW. 4 | 98.0000.0 98.0000.0 |
| CDC #2 | 98.0000.0 | 98.0000.0 |
| SECONDARY | CASE VEHICLE SECONDARY CDC | CONTACTED VEHICLE ASSOCIATED CD |
| SECONDARY | CASE VEHICLE SECONDARY CDC | CONTACTED VEHICLE ASSOCIATED CD |
| EVENT NUMBER | 13 | |
| IMPACT SPEED (km/h) | 14 15 16 | 35 36 37 |
| ESTIMATED BY | 17 | 38 |
| CRUSH (cm) | 18 19 20 | 39 40 41 |
| CDC #1 | 21 | 42 |
| CDC #2 | 28 - 34 | 49 |
| Codes | | |
| EVENT NUMBER | IMPACT SPEED ESTIMATOR | CRUSH |
| (8) NOT APPLICABL (9) UNKNOWN | .E (1) INVESTIGATOR (2) DRIVER (3) POLICE | (998) NOT APPLICABLE (NO VEHICLE/DAMAGE) |
| IMPACT SPEED | (4) *CRASH* PROGRAM (5) OTHER COMPUTER PROGRAM | (999) UNKNOWN |
| (998) NOT APPLICA (999) UNKNOWN | BLE SPECIFY: | (9800000) NOT APPLICABLE (9900000) UNKNOWN |

Module <u>D</u> <u>A</u> Format <u>0</u> <u>1</u> 12 Duplicate columns 1-8 DAMAGE DA-2 from the previous card. MAXIMUM SHEET METAL CRUSH (cm) (999) UNKNOWN $\frac{O}{13} \frac{O}{15}$ FRONT 0 7 3 RIGHT SIDE 0 0 D REAR 0 0 0 LEFT SIDE \mathcal{O} \mathcal{O} \mathcal{O} ROOF OTHER

CHRONOLOGICAL SEQUENCE OF DAMAGE/INJURY PRODUCING CRASH EVENTS FOR CASE VEHICLE

NOTE: IF CHRONOLOGICAL ORDER IS UNKNOWN, EVENT ORDER IS OPTIONAL.

DO YOU KNOW THIS TABLE TO BE IN CHRONOLOGICAL ORDER?

 $\frac{l}{31}$

(0) NO (1) YES

| | IMPACT LOCATION (1) ON ROADWAY (2) SHOULDER/MEDIAN/GORE (3) ON ROADSIDE (4) OUTSIDE ROADSIDE RIGHT-OF-WAY (5) OTHER (6) OFF ROADWAY, LOC. UNK. (9) UNKNOWN | IMPACT CONFIGURATION FOR CODES, SEE TABLE ON PAGE DA-3. | OBJECT/VEHICLE CONTACTED FOR CODES, SEE TABLE ON PAGE DA-4. |
|-----|---|--|--|
| # 1 | 4/32 | <u>47</u> | 77 Tall |
| #2 | 37 | | - 41 |
| #3 | 42 | | |
| #4 | 47 | | 51 |
| #5 | 52 | | |
| #6 | 57 | | 61 |
| #7 | 62 | 84 | |

CODES FOR IMPACT CONFIGURATION

FRONT OF CASE VEHICLE

- (11) AND FRONT OF CONTACTED VEHICLE
- (13) AND SIDE OF CONTACTED VEHICLE
- (14) AND REAR OF CONTACTED VEHICLE
- (16) ENDSWIPED BY CONTACTED VEHICLE
- (17) AND OBJECT
- (19) AND <u>UNKNOWN</u> OTHER VEHICLE CONFIGURATION

LEFT SIDE OF CASE VEHICLE

- (21) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (22) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (23) AND SIDE OF CONTACTED VEHICLE (NOT SIDÉSWIPE)
- (24) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (25) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (26) SIDESWIPED BY CONTACTED VEHICLE
- (27) AND OBJECT
- (29) AND UNKNOWN OTHER VEHICLE CONFIGURATION

REAR OF CASE VEHICLE

- (31) AND <u>FRONT</u> OF CONTACTED VEHICLE (33) AND <u>SIDE</u> OF CONTACTED VEHICLE
- (34) AND REAR OF CONTACTED VEHICLE
- (36) ENDSWIPED BY CONTACTED VEHICLE
- (37) AND OBJECT
- (39) AND UNKNOWN OTHER VEHICLE CONFIGURATION

RIGHT SIDE OF CASE VEHICLE

- (41) AND FRONT OF CONTACTED VEHICLE (TYPE T)
- (42) AND FRONT OF CONTACTED VEHICLE (TYPE L)
- (43) AND SIDE OF CONTACTED VEHICLE (NOT SIDESWIPE)
- (44) AND REAR OF CONTACTED VEHICLE (TYPE T)
- (45) AND REAR OF CONTACTED VEHICLE (TYPE L)
- (46) SIDESWIPED BY CONTACTED VEHICLE
- (47) AND OBJECT
- (49) AND UNKNOWN OTHER VEHICLE CONFIGURATION

OTHER

- (57) VEHICLE TO OBJECT
- (58) VEHICLE TO VEHICLE
- (59) VEHICLE TO VEHICLE, CONFIGURATION UNKNOWN

ROLLOVER

- (61) LESS THAN 360°
- (62) 360° OR MORE
- (69) DETAILS UNKNOWN

UNKNOWN

(99) IMPACT TYPE UNKNOWN

CODES FOR VEHICLE/OBJECT CONTACTED

VEHICLE/OBJECT GROUPS

- NO OBJECT (00)
- (01) (39) PASSENGER VEHICLE & TRUCK
- (40) (69) OTHER VEHICLE
- (70) (76) PEDESTRIAN & ON-ROADWAY OBJECT
- (77) (97) OFF-ROADWAY OBJECT
- (98)
- OTHER (DESCRIBE) (99)UNKNOWN

PASSENGER VEHICLE

- (02) LARGE
- (03) LIMOUSINE
- (17) PICKUP
- (20) UNKNOWN PASSENGER VEHICLE BODY
- (24) SUB-MINI
- (25) MINI
- (26) SUB-COMPACT
- (27) COMPACT
- (28) INTERMEDIATE
- (29) FULL

SIZE

WHEELBASE

- SUB-MINI < 2286 mm (< 90") 2286 - 2412 mm (90" - 94.9") SUB-COMPACT 2413 - 2539 mm (95" - 99.9") COMPACT 2540 - 2666 mm (100" - 104.9") INTERMEDIATE 2667 - 2793 mm (105" - 109.9") 2794 - 2920 mm (110" - 114.9") FULL LARGE 2921 - 3174 mm (115" - 124.9") LIMOUSINE > 3175 mm (> 125°)
- MULTIPURPOSE PASSENGER VEHICLE
 - (11) SMALL VAN (MINI)
 - (12) PICKUP
 - (14) SMALL UTILITY (WHEELBASE LESS THAN 107". E.G. JEEP, BRONCO)
 - (15) LARGE UTILITY (WHEELBASE MORE THAN 107", E.G. PANEL TRUCK, SUBURBAN)
 - (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
 - (17) PICKUP CAR with CANOPY/SHELL COVER
 - (21) MOTOR HOME
 - (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
 - (23) PICKUP CAR WITH SLIDE-IN CAMPER
 - (31) CHASSIS-MOUNTED CAMPER

TRUCK

- (11) SMALL VAN (E.G. ECONOLINE)
- (12) PICKUP TRUCK
- (13) UNKNOWN LIGHT TRUCK
- (15) LARGE UTILITY (E.G. PANEL TRUCK, SUBURBAN)
- (16) PICKUP TRUCK WITH CANOPY/SHELL COVER
- (22) PICKUP TRUCK WITH SLIDE-IN CAMPER
- (30) UNKNOWN TRUCK TYPE
- (31) CHASSIS-MOUNTED CAMPER
- (33) DELIVERY VAN (WALK-IN)
- (34) STRAIGHT TRUCK
- (35) TRUCK-TRACTOR (BOBTAIL)
- (36) CHASSIS-CAB
- (37) UNKNOWN HEAVY TRUCK
- (38) TRACTOR & SEMI-TRAILER (SEMI)
- (39) TRUCK (OR SEMI) & FULL TRAILER(S)

Bus

- (40) UNKNOWN BUS TYPE
- (41) SCHOOL BUS
- (42) INTERCITY BUS (BETWEEN CITIES)
- (43) TRANSIT BUS (INTRACITY)
- (44) STREETCAR (ON TRACKS)

MOTORCYCLE

- (50) UNKNOWN MOTORCYCLE TYPE
- (51) 1 75 cc
- (52) 76 125 cc (53) 126 250 cc
- (54) 251 500 cc (55) 501 - 750 cc
- (56) 751 cc +
- (57) 3-WHEELS (OR WITH SIDECAR)

SPECIAL PURPOSE VEHICLE

- (60) UNKNOWN/OTHER SPECIAL VEHICLE (DESCRIBE)
- (61) SNOWMOBILE
- (62) ATV (ALL TERRAIN VEHICLE)
- (63) AMPHIBIOUS VEHICLE
- (64) FARM VEHICLE
- (65) CONSTRUCTION VEHICLE
- (66) TRAILER, PRIVATE (CAMPER)
- (67) TRAILER, COMMERCIAL (CARGO)
- (68) TRAIN (CARS)
- (69) LOCOMOTIVE (ENGINE, SWITCHER)

OBJECT

- (70) PEDESTRIAN
- (71) BICYCLIST, OTHER PEDALCYCLIST
- (72) PEDESTRIAN CONVEYANCE (E.G. PERSON RIDING ANIMAL, CART)
- (73) LARGE ANIMAL
- (74) FALLEN OBJECT (E.G. OBJECT DISLODGED FROM OTHER VEHICLE, FALLEN TREE, ROCKS)
- (75) ROCKS
- (76) CONSTRUCTION EQUIPMENT (EXCLUDING (65))
- (77) SIGN POST, UTILITY POLE, TREE
- (78) DITCH
- (79) EMBANKMENT, SNOWBANK, RR TRACKS RR X
- (80) GROUND (ROLLOVER ONLY)
- (81) CURB (DAMAGE PRODUCING IMPACTS ONLY)
- (82) CULVERT
- (83) FENCE
- (84) HYDRANT, SHORT POST, STUMP
- (85) SMALL POST/TREE, RURAL MAIL BOX, MILE MARKER, DELINEATOR
- (86) BUILDING
- (87) PIER, PILLAR, BRIDGE SUPPORT
- (88) ABUTMENT, RETAINING WALL
- (89) BRIDGE RAIL
- (90) GUARD RAIL, LEADING SECTION (91) GUARD RAIL, MIDDLE OR UNKNOWN
- (92) GUARD RAIL, TRAILING SECTION (93) GUARD POST (TIMBER, METAL, CONCRETE)
- (94) CABLE, FENCE BARRIER
- (95) CONCRETE BARRIER (MEDIAN)
- (96) IMPACT ATTENUATOR
- (97) BREAKAWAY FEATURES

CRASH RECONSTRUCTION Duplicate columns 1-8 Module C R Format 0 1 CR-1 from the previous card. 10 11 12 for ΔV CASE VEHICLE PRIMARY IMPACT CASE VEHICLE SECONDARY IMPACT CASE CONTACTED CASE CONTACTED **VEHICLE VEHICLE VEHICLE VEHICLE EVENT NUMBER** ΔV (km/h) TOTAL 66 87 68 LONGITUDINAL* 54 72 LATERAL* 58 NOTE: THESE AV COMPONENTS 76 MUST INCLUDE SIGN. EXAMPLES: 10 km/h = ± 0 1 0 -7 km/h = : 00 Z **ENERGY DISSIPATED BY** <u>O</u> 1 9 <u>0</u> 28 CRUSH (kj) 62 77 RECONSTRUCTION (01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL 63 64 (21) RECONSTRUCTED, LOW CONFIDENCE LEVEL (22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL (23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL NOT RECONSTRUCTED BECAUSE (02) INSUFFICIENT DATA (03) EXCESSIVE UNDERRIDE/ OVERRIDE (04) ROLLOVER (05) VAULTING (06) OTHER TRAVEL IN MORE THAN ONE PLANE (07) NON-HORIZONTAL FORCE (08) SIDESWIPE-TYPE DAMAGE (09) YIELDING OBJECT (10) OTHER: (11) AT LEAST ONE VEHICLE **BEYOND SCOPE** (12) OTHER VEHICLE NOT INSPECTED MODE (1) CDC ONLY (2) CDC & DETAILED DAMAGE (3) TRAJECTORY & CDC 65 (4) TRAJECTORY & CDC & **DETAILED DAMAGE** (5) NOT RECONSTRUCTED **COMPUTER PROGRAM** SPECIFY:_

| Duplicate columns 1-8 Module <u>C</u> <u>F</u> from the previous card. | Format <u>0 2</u> | | H RECONSTRUCTEBS | TION CR-2 | | |
|---|-------------------------------|----------------------|-------------------------------|----------------------|--|--|
| | CASE VEHICLE P | RIMARY IMPACT | CASE VEHICLE SECONDARY IMPACT | | | |
| | CASE VEHICLE | CONTACTED VEHICLE | CASE VEHICLE | CONTACTED VEHICLE | | |
| EVENT NUMBER | 13 | | 47 | | | |
| EBS (km/h) TOTAL | 0 3 5 | 32 33 34 | 48 49 50 | 66 67 68 | | |
| LONGITUDINAL* | <u>-006</u> | 35 38 | 51 54 | 69 72 | | |
| LATERAL* | -034 | 8 | | | | |
| *NOTE: THESE EBS COMPONENTS MUST INCLUDE SIGN. | 21 24 | 39 42 | 55 58 | 73 76 | | |
| EXAMPLES: 10 km/h = ± Q 1 Q -7 km/h = <u>:</u> Q Q Z | | | | | | |
| ENERGY DISSIPATED BY CRUSH (ki) | $0 \frac{1}{25} \frac{9}{28}$ | 8 | 59 62 | 77 — — 80 | | |
| RECONSTRUCTION | | | | | | |
| (01) RECONSTRUCTED, UNKNOWN CONFIDENCE LEVEL | 22 | | | | | |
| (21) RECONSTRUCTED, LOW CONFIDENCE LEVEL (22) RECONSTRUCTED, MODERATE CONFIDENCE LEVEL (23) RECONSTRUCTED, HIGH CONFIDENCE LEVEL | 29 30 | | 63 64 | | | |
| NOT RECONSTRUCTED BECAUSE | | | | | | |
| (02) INSUFFICIENT DATA (03) EXCESSIVE UNDERRIDE/ OVERRIDE (04) ROLLOVER (05) VAULTING (06) OTHER TRAVEL IN MORE THAN ONE PLANE (07) NON-HORIZONTAL FORCE (08) SIDESWIPE-TYPE DAMAGE | | | | | | |
| (09) YIELDING OBJECT (10) OTHER: (11) AT LEAST ONE VEHICLE BEYOND SCOPE (12) OTHER VEHICLE NOT INSPECTED | | | | | | |
| MODE | | | | | | |
| (1) CDC ONLY (2) CDC & DETAILED DAMAGE (3) TRAJECTORY & CDC (4) TRAJECTORY & CDC & DETAILED DAMAGE (5) NOT RECONSTRUCTED | 31 | | 65 | | | |
| COMPUTER PROGRAM SPECIFY: | | | | | | |

Duplicate columns 1-8 from the previous card. Module <u>C</u> <u>R</u> Format <u>0</u> <u>3</u> 10 11 12

CRASH RECONSTRUCTION

CR-3

NOTES:

- 1. ENTER CRASH RECONSTRUCTION DAMAGE MEASUREMENTS IN <u>CENTIMETERS</u>.
- 2. MEASURE C $_1$ TO C $_6$ FROM DRIVER TO PASSENGER SIDE IN FRONT OR REAR IMPACTS, REAR TO FRONT IN SIDE IMPACTS.

CASE VEHICLE


LOCATOR


- 3. D IS POSITIVE IF MEASURED TO A POINT FORWARD OF OR TO THE RIGHT OF THE CG.
- 4. USE THE CENTER OF THE WHEELBASE AS THE CG.

Locate the end of the damage with respect to the vehicle longitudinal center line, or an undamaged axle for side impacts.

| Specific Impact No. | Location of Direct Damage | Location of Field L |
|---------------------|-----------------------------|----------------------|
| 1 | begin so cm near of 1864 BC | Ze3 cm rem of nittle |
| | | Begin Kt. ft. BC |
| | | |

STANDS @ 120 cm from Center

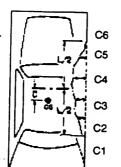

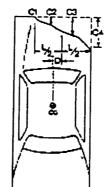

DL

UDL

PLANE:

- (1) Bumper
- (2) Above Bumper
- (3) Sill
- (4) Above Sill
- (5) Other_
- (9) Unknown

CRUSH PROFILE IN CENTIMETERS

| | NOTE: Each | line in the tal | ole below is a | separate rec | ord (card). | Du | plicate col | umns 1 - 1 | 2 for each | complete | d line |
|------------------------------|---------------------------------|---------------------------|------------------------|--------------|----------------|----------------|----------------|----------------|----------------|----------------|-------------|
| Specific Impact Number | Plane of Impact C-Measur. | Direct Length (DDL) | Damage Max Crush | Field | C ₁ | C ₂ | C ₃ | C ₄ | C ₅ | C ₆ | ±D |
| 1 | 4 | 54 | 95 | 223 | 0 | 8 | 3/ | 95 | 68 | 31 | +135 |
| | FREESMICE STAND Adjust | | | | -1 | -1 | -1 | 0 | 0 | 6 | |
| | Adjosta | an I | -22 | | ٠٤٤ | -22 | -22 | 22 | .22 | -27 | |
| | | | | | | | | | | | |
| 1 | 4 | 056 | 073 | 223 | 000 | 000 | 008 | 073 | 046 | 003 | +135 |
| 13 | 14 | 15 16 17 | 18 19 20 | 21 22 23 | 24 25 26 | 27 28 29 | 30 31 32 | 33 34 35 | 36 37 38 | 39 40 41 | 42 43 44 45 |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| 2 | | | | | | | | | | | |

| Duplicate from the | e columns 1-8 previous card. | Module <u>C</u> | R Forma | nt <u>0 4</u> | | Cr | RASH R | ECONS | TRUCTI | ON | CR-4 |
|---|---------------------------------|---|------------------|---------------------------------------|----------------|----------------|----------------|----------------|----------------|----------------|-------------|
| NOTES | 2. MEAS | R CRASH RECO URE C ₁ TO C ₆ TS, REAR TO F | FROM DRIVER | TO PASSENGI | | | | | Отне | R VEH | CLE |
| | | OSITIVE IF ME | | | RD OF OR | TO THE RIG | HT OF THE | CG. | LC | CATOF | l |
| | | HE CENTER OF | | | | | | | | | : |
| Locate | the end of the d | lamage with re | spect to the v | ehicle longitu | dinal cente | er line, or a | ın undama | ged axle fo | or side imp | acts. | |
| Specific | Impact No. | | Location of | Direct Dar | nage | | | Locati | on of Fie | eld L | |
| | ····· | | | | | | | | | | |
| | | | ····· | · · · · · · · · · · · · · · · · · · · | | | . | | | | |
| | | | | | | | | | | | |
| PLANE: (1) Bumper (2) Above Bumper (3) Sill (4) Above Sill (5) Other (9) Unknown | | | | ITIMETE | :BS | DL UDL | | | | | |
| Specific | NOTE: Each | line in the tat | ole below is a s | separate reco | ord (card). | | olicate colu | ımns 1 - 1 | 2 for each | completed | l line. |
| Impact Number | of Impact C-Measur. | Length (DDL) | Max Crush | Field L | C ₁ | C ₂ | C ₃ | C ₄ | C ₅ | C ₆ | ±D |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| | | | | | | | | | | | |
| 13 | 14 | 15 16 17 | 18 19 20 | 21 22 23 | 24 25 26 | 27 28 29 | 30 31 32 | 33 34 35 | 36 37 38 | 39 40 41 | 42 43 44 45 |
| | | | | | | | | | 20 07 00 | 35 70 41 | 76 90 94 45 |

| Duplicate columns 1-8 Module W T from the previous card. | Format 0 1 | WHEELS AND TIRES WT-1 |
|---|-------------------------------|-----------------------------|
| WHEELSDAMAGED (0) NO (1) YES (9) UNKNOWN | LF (1) | LF <u>P 2 4 5 7 5 R 1 6</u> |
| TIRE TREAD TYPE (1) REGULAR (2) SNOW (3) SLICKS (4) ALL WEATHER (MS) (7) OTHER: (9) UNKNOWN | LF | LR 55 |
| CARCASS CONSTRUCTION (1) BIAS (2) BELTED BIAS (3) RADIAL (4) ELLIPTICAL (5) HI PRESSURE SPARE (6) SPACE SAVER SPARE (7) OTHER: (9) UNKNOWN | LF 3 RF 3 RR 3 LR 24 | |
| IF VEHICLE IS EQUIPPED WITH DUAL WHEELS, COMPLETE FOR OUTER WHEELS AND MAKE NOTES ON INNER WHEELS. NOTES: | | |

| Duplicate columns 1-8 Module F T Forma from the previous card. | at <u>0 1</u> | FUEL AND FUEL TANKS | FT-1 |
|--|---------------|---|-------------|
| TYPE OF PROPULSIVE FUEL (1) GASOLINE (2) DIESEL OIL (3) LPG (4) ELECTRIC (7) OTHER: (9) UNKNOWN | 13 | AUXILIARY TANK TYPE (1) OEM TANK (2) AFTER MARKET TANK (8) NOT APPLICABLE (NOT EQUIPPED) (9) UNKNOWN | 21 |
| MAIN TANK LOCATION | 1 22 | AUXILIARY TANK LOCATION | 888 |
| MAIN FILLER CAP LOCATION | 1 1 3 | AUXILIARY FILLER CAP LOCATION | <u>888</u> |
| MAIN TANK MATERIAL | 20 | AUXILIARY TANK MATERIAL | 8 28 |
| | | | |

TANK AND FILLER CAP LOCATION CODES

FIRST DIGIT (LONGITUDINAL)

- (1) BEHIND KICK-UP
- (2) IN KICK-UP
- (3) BETWEEN KICK-UP & COWL
- (4) FORWARD OF COWL
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

SECOND DIGIT (LATERAL)

- (1) LEFT OF FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) RIGHT OF FRAME
- (4) DUAL, RIGHT & LEFT TANKS
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

THIRD DIGIT (VERTICAL)

- (1) BELOW FRAME
- (2) WITHIN FRAME OR CENTERED
- (3) ABOVE FRAME
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

TANK MATERIAL CODES

- (1) STEEL
- (2) ALUMINUM
- (3) PLASTIC
- (7) OTHER
- (8) NOT APPLICABLE (NOT EQUIPPED)
- (9) UNKNOWN

Duplicate columns 1-8 from the previous card.

Module <u>F</u> <u>L</u> Format <u>0</u> <u>1</u> 12

FUEL LEAKAGE

FL-1

DID FUEL LEAKAGE RESULT FROM A CRASH EVENT

(0) NO KNOWN LEAKAGE SKIP PAGE.

(1) YES COMPLETE PAGE.

Q

| | 1 | 11 | III | IV | V | |
|----------------|----------------------|---------------------|-------------------|-----------------------|---------------------|-----------------|
| LEAK NUMBER | LEAKING COMPONENT | COMPONENT SOURCE | TYPE OF DAMAGE | SEVERITY OF DAMAGE | LOCATION OF LEAK | EVENT NUMBER |
| #1 | 14 15 | | | | | 21 |
| #2 | 22 23 | | - | | | 29 |
| #3 | 30 31 | | | | | 37 |
| #4 | 38 39 | | | | | 45 |
| #5 | 46 47 | | | | | 53 |

LEAKING COMPONENT

TANK AREA

- (11) MAIN FUEL TANK (INCLUDING VAPOR RECOVERY DOME)
- (12) AUXILIARY FUEL TANK
- (13) MAIN TANK FILLER TUBE
- (14) MAIN TANK CAP (GAS CAP)
- (15) AUXILIARY TANK FILLER TUBE
- (16) AUXILIARY TANK CAP (GAS CAP)
- (19) TANK AREA, DETAILS UNKNOWN

DELIVERY SYSTEM

- (21) FUEL FEED LINE (MAIN TANK TO FUEL PUMP)
- (22) FUEL FEED LINE (AUXILIARY TANK TO FUEL PUMP)
- (23) FUEL RETURN LINE (FUEL PUMP TO TANK)
- (24) INLINE FUEL FILTER
- (25) FUEL LINE (PUMP TO CARBURETOR OR INJECTOR PUMP)
- (26) CARBURETOR TO INJECTOR PUMP
- (27) FUEL PUMP
- (29) DELIVERY SYSTEM, DETAILS UNKNOWN

EVAPORATIVE EMISSION CONTROL SYSTEM

- (31) ATMOSPHERIC VENT PIPE (NON-EEC EQUIPPED)
- (32) EEC PIPE (VAPOR CANISTER TO CARBURETOR)

EEC SYSTEM (CONTINUED)

- (33) VAPOR RECOVERY HOSES (CANISTER TO CARBURETOR)
- (34) LIQUID-VAPOR SEPARATOR (UNLESS PART OF TANK)
- (35) CANISTER
- (39) EEC SYSTEM, DETAILS UNKNOWN
- (49) ENGINE COMPARTMENT, COMPONENT UNKNOWN
- (99) COMPONENT UNKNOWN

II COMPONENT SOURCE

- (1) OEM
- (2) AFTER MARKET
- (9) UNKNOWN

III TYPE OF DAMAGE

- (1) DENTED/CRUSHED
- (2) PUNCTURED
- (3) RUPTURED
- (4) SEVERED/GROSS TEARS
- (5) DISCONNECTED/DEFEATED
- (9) UNKNOWN

IV SEVERITY OF DAMAGE

- (1) MINOR
- (2) MODERATE
- (3) SEVERE
- (4) DISCONNECTED/DEFEATED
- (9) UNKNOWN

V LOCATION OF LEAK

FIRST DIGIT (LONGITUDINAL LOCATION)

- (1) F, FORWARD OF COWL
- (2) P, BETWEEN COWL & REAR BULKHEAD
- (3) B, BEHIND REAR BULKHEAD
- (4) Y, F, & P
- (5) Z, P, & B
- (6) D, DISTRIBUTED (F, P & B)
- (9) UNKNOWN

SECOND DIGIT (LATERAL LOCATION)

- (1) L, LEFT
- (2) C, CENTER
- (3) R. RIGHT
- (4) Y, LEFT CENTER (L & C)
- (5) Z, RIGHT CENTER (R&C)
- (6) D. DISTRIBUTED
- (F, P & B)
 (9) UNKNOWN

| Duplicate columns 1-8 Module F R Format 0 from the previous card. 9 10 11 | | FIRE | FR-1 |
|---|-----|--|------|
| WAS THERE FIRE IN (0) NO <u>SKIP</u> PAC (1) YES <u>COMPLE</u> | GE. | CASE VEHICLE? O 13 | |
| DID FIRE START IN CASE VEHICLE? (0) NO (1) YES (9) UNKNOWN | 14 | SEVERITY OF FIRE DAMAGE (1) MINOR (2) MODERATE (3) SEVERE (9) UNKNOWN | 16 |
| FLAME PROPOGATION RATE (1) RAPID/EXPLOSIVE (2) SLOW/MODERATE (9) UNKNOWN | 15 | DID AN INJURY TO CASE VEHICLE OCCUPANT RESULT FROM FIRE IN OR ON CASE VEHICLE? (0) NO (1) YES (9) UNKNOWN | 17 |

PROVIDE NOTES IF FIRE OCCURRED.

| Duplicate columns 1-8 from the previous card. Module E | D Format | 0 <u>1</u> 11 12 | EXTERIOR DAMAGE | ED-1 |
|--|-------------------------|--------------------------|--|---------|
| Hood Performance | | | STEERING COL FLEXIBLE COUPLING | |
| FOR THE FOLLOWING, USE CODE | S: | | FLEXIBLE COUPLING TYPE | |
| (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | | | (0) NONE (1) FLEXIBLE MATERIAL (2) POT (3) SINGLE U-JOINT (4) DOUBLE U-JOINT (5) FLEXIBLE CABLE (6) COMBINATION OF ABOVE (CIRCLE EACH) | 9 26 |
| HOOD LATCH(ES)- | -RELEASED | 13 | (7) OTHER: (8) EQUIPPED, TYPE UNKNOWN (9) UNKNOWN, IF EQUIPPED | |
| | -DAMAGED | 1 | 00170.00 | |
| • | -JAMMED | 1 15 | COUPLINGDAMAGED (USE CODES FROM HOOD | 9 27 |
| HOOD HINGESLEFT, | DAMAGED | 1 16 | PERFORMANCE) -SEPARATED (COMPLETE) | 9 28 |
| | SEPARATED (COMPLETE) | | | |
| -RIGHT, (| DAMAGED | 1 | ENG COMPART TELESCOPING UNIT | |
| | SEPARATED COMPLETE) | 18 0 | TYPE OF UNIT (00) NONE INSTALLED (01) - (07) SEE UNITS ON PAGE ED-2 (88) NOT COLLECTED (97) OTHER: (98) EQUIPPED, TYPE UNKNOWN (99) UNKNOWN IF EQUIPPED | 8 8 30 |
| REAR EDGE OF HOOD- | ELEVATED | 1 | ORIGINAL LENGTH (mm) | |
| -CONTACTED W | INDSHIELD | $\frac{1}{z}$ | F (OR H): | |
| -PENETRATED WI | NDSHIELD | $\frac{\mathcal{O}}{23}$ | TELESCOPED LENGTH (mm) | ē |
| HOOD LATCH LOCATION | | | G: | |
| (1) FRONT OF VEHICLE (2) COWL AREA (3) SIDE (8) NOT APPLICABLE (9) UNKNOWN | | 1/24 | DIFFERENCE (mm) F (OR H) - G (IF LESS THAN 15mm, ENTER *000*.) | |
| ENGINE OR TRANSMISSION MC SEPARATION <i>(COMPLETE)</i> (0) NO (1) YES (9) UNKNOWN | DUNT | <i>O</i> | (888) NOT COLLECTED (991) NOT MEASURED/NO COMPRESSION (992) COMPRESSED, AMOUNT UNKNOWN (993) DEVICE EXTENDED (997) UNABLE TO BE MEASURED (998) NOT APPLICABLE (NOT EQUIPPED) (999) UNKNOWN | 8 8 8 3 |

| | | Exterior Damage | ED-2 |
|---|----------------|--|------|
| LEFT-SIDE BODY MOUNT DID BODY MOUNT SEPARATE? (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | <u>Q</u> 34 | LEFT DOORS HOW DID DOORS OPEN DURING COLLISION? | |
| LEFT PILLARS PILLARS SEPARATED COMPLETELY - USE CODES: (0) NO (1) YES (4) NO SEPARATION, BUT DAMAGED (8) NOT APPLICABLE (NOT EQUIPPED) (9) UNKNOWN | | USE CODES: (0) DOOR DID NOT OPEN OPENED BECAUSE OF (1) HINGE AREA SEPARATION (2) DOOR-LATCH SEPARATION (3) LATCH-STRIKER SEPARATION (4) STRIKER-PILLAR SEPARATION (5) BODY DISTORTION (6) COMBINATION OF ABOVE (CIRCLE EACH) (7) OPENED, REASON UNKNOWN | |
| -A-PILLAR, UPPER | Q 35 | (8) NOT APPLICABLE <i>(NO DOOR)</i> (9) UNKNOWN | |
| LOWER | <u>O</u> 36 | -FRONT -REAR | Q 4 |
| -B-PILLAR, UPPER LOWER | <u>O</u> 37 | DOORS JAMMED CLOSED- USE CODES: | |
| -C-PILLAR, UPPER | <u>O</u> | (0) NO (1) YES (8) NOT APPLICABLE <i>(NO DOOR)</i> (9) UNKNOWN | |
| LOWER | <u>O</u> | -FRONT | 0 45 |
| -D-PILLAR, UPPER | <u>ð</u> | -REAR | Q 45 |
| LOWER | _Q | | |
| | | | |

| | | EXTERIOR DAMAGE | ED-3 |
|--|----------|---|----------------|
| | | OTHER REAR DAMAGE | |
| REAR DOOR REAR DOOR TYPE | | WAS PARTITION TO LUGGAGE AREA DAMAGED DURING COLLISION? | |
| (0) NO DOOR (INCLUDES PICKUPS) (1) HATCHBACK (2) ONE-WAY TAILGATE (3) TWO-WAY TAILGATE (4) CLAMSHELL/DISAPPEARING | 6 47 | (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | 50 |
| TAILGATE (5) SINGLE DOOR (6) DOUBLE DOOR | | SPARE TIRE | |
| (9) UNKNOWN Hatchback | | (0) NO SPARE TIRE (1) NOT ATTACHED BEFORE COLLISION (2) ATTACHED, NOT SEPARATED IN COLLISION (3) ATTACHED, SEPARATED DUE TO COLLISION (8) NOT COLLECTED | <u>8</u> 51 |
| One-way — | | (9) UNKNOWN | |
| Two-way or or | | TRAILER HITCH TYPE (0) NO HITCH | 2 |
| Clamshell | | BALL-AND-SOCKET TYPES (1) TEMPORARY FRAMEWORK <i>(E.G.</i> | 52 |
| Single door | | (1) RENTAL CLAMP-ON) (2) BUMPER-MOUNT ONLY (E.G. LIGHT TRUCK) (3) BUMPER-AND-FRAME (BUT NON-EQUALIZING) | |
| Double door | | (4) LOAD EQUÁLIZING OTHER TYPES | |
| HOW DID DOOR OPEN DURING COLLISION? | | (5) RING-AND-PINTLE (6) FIFTH-WHEEL (INCL. P/U) (7) OTHER (E.G. CLEVIS-AND-PIN) | |
| (0) DOOR DID NOT OPEN OPENED BECAUSE OF | <u>0</u> | (8) EQUIPPED, TYPE UNKNOWN (9) UNKNOWN IF EQUIPPED | |
| (1) HINGE AREA SEPARATION (2) DOOR-LATCH SEPARATION (3) LATCH-STRIKER SEPARATION (4) STRIKER-PILLAR SEPARATION (5) BODY DISTORTION | | TRAILER TYPE (AT TIME OF COLLISION) | 2 |
| (6) COMBINATION OF ABOVE (CIRCLE EACH) (7) OPENED, REASON UNKNOWN | | (0) NO TRAILER (1) TRAVEL-TRAILER/CAMPER (2) MOBILE HOME (3) BOAT/SNOWMOBILE/ATV TRAILER | 53 |
| (8) NOT APPLICABLE <i>(NO DOOR)</i> (9) UNKNOWN | | (4) UTILITY TRAILER (5) TOWED CAR (7) OTHER: (8) TRAILER, TYPE UNKNOWN | |
| DOOR JAMMED CLOSED (0) NO | 0 | (9) UNKNOWN | |
| (0) NO (1) YES (8) NOT APPLICABLE (NO DOOR) (9) UNKNOWN | 49 | | |

| | | EXTERIOR DAMAGE E | ED-4 |
|--|--------------------------|--|-------------------|
| RIGHT-SIDE BODY MOUNT DID BODY MOUNT SEPARATE? (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | 54 | RIGHT DOORS HOW DID DOORS OPEN DURING COLLISION? USE CODES: | |
| RIGHT PILLARS PILLARS SEPARATED COMPLETELY - USE CODES: (0) NO (1) YES (4) NO SEPARATION, BUT DAMAGED (8) NOT APPLICABLE (NOT EQUIPPED) (9) UNKNOWN | | (00) DOOR DID NOT OPEN OPENED BECAUSE OF (01) HINGE AREA SEPARATION (02) DOOR-LATCH SEPARATION (03) LATCH-STRIKER SEPARATION (04) STRIKER-PILLAR SEPARATION (05) BODY DISTORTION (06) COMBINATION OF ABOVE (CIRCLE EACH) (07) OPENED, REASON UNKNOWN (11) VAN RIGHT-REAR DOOR OPENED (ANY MECHANISM) | |
| -A-PILLAR, UPPER | <u>4</u> 55 | (98) NOT APPLICABLE <i>(NO DOOR)</i> (99) UNKNOWN -FRONT | <u>0</u> 0 |
| LOWER | 56 <u>4</u> 57 | -REAR | <u>Ø</u> <u>Ø</u> |
| LOWER | 4 58 | DOORS JAMMED CLOSED- USE CODES: (0) NO (1) YES (8) NOT APPLICABLE (NO DOOR) | |
| -C-PILLAR, UPPER | O 59 O 60 | (9) UNKNOWN -FRONT | <u>/</u> |
| -D-PILLAR, UPPER | $\frac{\mathcal{O}}{61}$ | -REAR | <u>8</u> |
| LOWER | <u>O</u> 62 | VAN REAR DOOR TYPE (0) VAN, NO REAR DOOR (1) TRACK (SLIDING) - RIGHT SIDE (2) SINGLE-HINGED - RIGHT SIDE (3) DOUBLE-HINGED - RIGHT SIDE (4) TRACK (SLIDING) - RIGHT & LEFT SIDE (5) SINGLE-HINGED - RIGHT & LEFT SIDE (6) DOUBLE-HINGED - RIGHT & LEFT SIDE (7) TRACK AND HINGED COMBINATION (8) NOT APPLICABLE (NOT A VAN) (9) UNKNOWN | 8 80 |

| | | EXTERIOR DAMAGE | ED- |
|---|-----------|--|------|
| WINDSHIELD DAMAGE | | WINDSHIELD MARK ON CASE VEHICLE | : |
| WINDSHIELD CRACKED (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | 70 | 1 | |
| WINDSHIELD BROKEN (PLASTIC INTERLAYER TORN) (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | 0 71 | | |
| CRACKED OR BROKEN BY OCCUPANT CONTACT (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN EXTENT OF BOND SEPARATION | 0 72 | WINDSHIELD CODE (97) DESCRIBED BUT NOT CODED (98) NOT APPLICABLE (NO WINDSHIELD) (99) UNKNOWN | 9 74 |
| (0) NONE (1) 1-20% (2) 21-40 (3) 41-60 (4) 61-80 (5) 81-99 (6) TOTAL (7) SEPARATED, AMOUNT UNKNOWN (8) NOT APPLICABLE (9) UNKNOWN | 73 | ROOF DID T-ROOF/SUN ROOF OPEN DURING COLLISION? (0) NO (1) YES (8) NOT APPLICABLE (NOT A T-ROOF OR SUN ROOF) (9) UNKNOWN | 76 |
| LOCATE AREA OF WINDSHIELD IN & HORIZONTAL) ON THIS DIAGRA | TEREST OF | R DAMAGE WITH DIMENSIONS (VERTICAL WINDSHIELD AS VIEWED FROM <u>INSIDE</u> . | • |

1441

Entine bottom = bond separated

L

ę


R


| Duplicate columns 1-8 from the previous card. Module S C Format 9 10 | 0 1 | STEERING WHEEL AND COLUMN | SC-1 |
|--|-------------|---|------|
| STEERING WHEEL | | STEERING WHEEL POSITION AT TIME OF COLLISION | |
| STEERING WHEEL RIM DAMAGE (0) NONE (1) DEFORMED SLIGHTLY (2) SEVERELY BENT (3) BROKEN (9) UNKNOWN | <u>O</u> 13 | IN WHAT O'CLOCK POSITION WAS THE NORMAL TOP OF THE WHEEL POINTED WHEN THE COLLISION OCCURRED? EXAMPLES O'CLOCK = 1 2 O'CLOCK = 0 2 | |
| NUMBER OF STEERING WHEEL SPOKES (9) UNKNOWN | 4 14 | (NORMAL STRAIGHT AHEAD) O'CLOCK - 9 9 | |
| STEERING WHL SPOKE DAMAGE (0) NONE (1) DEFORMED SLIGHTLY (2) SEVERELY BENT (3) BROKEN (9) UNKNOWN | <u>O</u> 15 | STEERING WHEEL ENERGY ABSORBING DEVICE (1) EXAMPLES: BARRACUDA, 70-74 CHALLENGER, 70-74 CAPRI, 71-77 | |
| Steering Column Options | | (2) EXAMPLES: OMNI, 78 - HORIZON, 78 - | |
| TILT FEATURE (0) NOT EQUIPPED (1) YES, EQUIPPED, UNK POSITION (2) UP (3) MIDDLE (4) LOWER (9) UNKNOWN IF EQUIPPED | 3 16 | TYPE OF DEVICE (0) NONE (1) CONVOLUTED OR MESH CYLINDER (2) DEEP DISH STEERING WHEEL (7) OTHER: (8) NOT COLLECTED (9) UNKNOWN IF EQUIPPED | 8 19 |
| SWING-AWAY FEATURE (0) NOT EQUIPPED (1) YES, EQUIPPED (9) UNKNOWN IF EQUIPPED | <u>O</u> | ORIGINAL DIMENSION (mm) A: DAMAGE DIMENSION (mm) B: | |
| TELESCOPING FEATURE (0) NOT EQUIPPED (1) YES, EQUIPPED (9) UNKNOWN IF EQUIPPED | 70 18 | DIFFERENCE (mm) A - B (888) NOT COLLECTED (991) NOT MEASURED/NO APPARENT COMPRESSION (992) COMPRESSED, AMOUNT UNKNOWN (993) DEVICE EXTENDED (997) UNABLE TO MEASURE (998) NOT APPLICABLE (NOT EQUIPPED) | 8 8 |


| | | STEERING WHEEL AND COLUMN | SC-2 |
|---|-----------------------------|------------------------------------|------|
| STEERING COLUMN ENERGY ABSORBING DEVICE | | STEERING WHEEL (CONTINUED) | |
| | | | |
| TYPE OF DEVICE * (IF 27 OR 28) | | STEERING WHEEL HUB DAMAGE | |
| (00) NOT EQUIPPED (88) NOT COLLECTED (99) UNKNOWN | $\frac{8}{23} \frac{8}{24}$ | (1) OCCUPANT CONTACT (2) AIRBAG | 33 |
| ORIGINAL LENGTH (mm) | | (3) OTHER | |
| C: | | | |
| COMPRESSED LENGTH (mm) | | | |
| D: | | | |
| BRACKET DEFLECTION (IF CODE 36, 48, OR 49 ABOVE) | | | , |
| COMPRESSION (OR EXTRUSION) (mm) | | | |
| C - D (OR E) (TOLERANCE: ±10) | | | |
| (888) NOT COLLECTED (991) NOT MEASURED/NO APPARENT COMPRESSION | 8 8 8 | | |
| (992) COMPRESSED, AMOUNT UNKNOWN (993) DEVICE EXTENDED (997) UNABLE TO BE MEASURED (998) NOT APPLICABLE (NOT EQUIPPED) (999) UNKNOWN | 25 27 | | |
| * (ADD A & B FOR TOTAL COMPRESSION) | | | |
| SHEAR CAPSULE SEPARATION (mm) | | | |
| S (USE AVG. OF LEFT & RIGHT CAPSULES.) | | | |
| LT: | | | |
| RT: | | | |
| (888) NOT COLLECTED (991) NOT MEASURED/NO APPARENT SEPARATION (992) SEPARATED, AMOUNT UNKNOWN (997) UNABLE TO BE MEASURED (998) NOT APPLICABLE (NOT EQUIPPED) (999) UNKNOWN | 8 8 8 | | · |
| COLUMN VERTICAL ROTATION | | | |
| (0) NO APPARENT ROTATION (1) UPWARD APPARENT ROTATION (2) DOWNWARD APPARENT ROTATION (9) UNKNOWN | 2 31 | | |
| COLUMN LATERAL ROTATION | | | |
| (0) NO APPARENT ROTATION (1) LEFT APPARENT ROTATION (2) RIGHT APPARENT ROTATION (9) UNKNOWN | 32 | | |

| | | | | | | | | Intrus | SION IT-1 |
|-----------------------|-----------------------------|--------------------|-----------------------------|----------------------------|----------------------|-------------------|-----------|-------------|-----------------------------------|
| | | | | | (All Meas | surements Are is | n Centime | eters) | |
| Location Intrusion | of on In | Intruded Component | | Compai Valu | rison e - | Intruded Value | = | Intrusion | Dominant Crush Direction |
| 11 | | TRAI | us Tunkel | | 62 | - 42 | = | 20 | Y |
| | | 16 | · | 126 | | _ | = | . 0 | × |
| _//_ | | E | <u> </u> | | 78 | 78 | = | 0 | X |
| | | <u> </u> | | <u> </u> | <u>-</u> | _ | = | | |
| 13 | | I | <u> </u> | | 78 - | - 67 | = | 1/ | X |
| 13 | • • | (19. | lan, desn loon | ļ | 62° | 52 | = | 10 | AY |
| 17 | 7 | FI | OON | | | - | = | | 2 |
| 13 | <i>y</i> 4 | 1-p1 | //An | | 94 | 85 | = | 9 | X |
| | | | | | _ | _ | = | | |
| | | | | | | - | = | | |
| | | | | ļ | | - | = | | |
| | | | | | | - | = | | |
| | | | | | | - | = | | |
| | | | | | | - | = | | |
| | | | | | | | = | | |
| | | | 0 | CCUPANT C | ONTACT | WORKSHE | = :FT | | |
| | T | I | | | | | | · | |
| Contact | Interio Compor Contac | nent | Occupant No. if Known | Body Region if Known | | Supporting I | Physica | ıl Evidence | Confidence Level of Contact Point |
| Α | KNEP | 16A | Pn | Rt. 209 | Scut | 4 | | | |
| В | (CNTER (DNSO | 48 | Dr | butto du | Scul | <i>{</i> | | | 1 |
| С | BOX | | RF | Legs | Scut | :t | | | 2 |
| D | Root | | Dr | Head | Scut Scut Scut | £+ | | | 1 |
| Ε | | | | | | | | | |
| F | | | | | | | | | |
| G | | | | | | | | | |
| Н | | \bot | | | | | | | |
| 1 | | \bot | | | | | | | |
| J | | | | | | | | | |



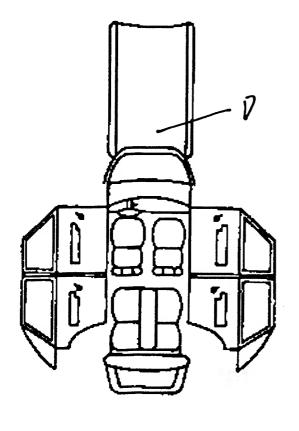

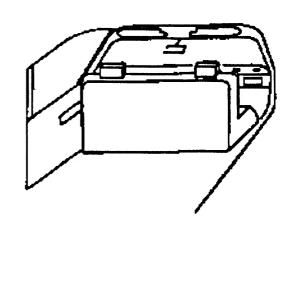

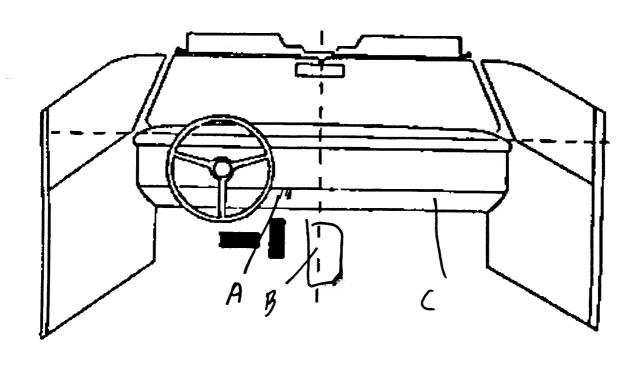

CODES FOR COLUMN B, OCCUPANT SPACE NUMBER

OCCUPANT SPACE NUMBER IS A TWO-DIGIT CODE. THE USE OF THE CODE IS DETERMINED BY THE VEHICLE SEAT CONFIGURATION AT THE TIME OF THE ACCIDENT.

FIRST DIGIT

THE FIRST DIGIT (LEFT DIGIT) DENOTES THE SEAT ROW, WITH CODE VALUES FROM 1 TO 5.

SECOND DIGIT

THE SECOND DIGIT (RIGHT DIGIT) DENOTES THE POSITION ON THE SEAT AND, IN SOME INSTANCES, THE WIDTH OF THE SEAT.


| (1) | LEFT | (3) RIGHT | | . INDIVIDUAL SEAT |
|-----|-----------------|--------------------|---------------------|--------------------------------|
| (1) | LEFT | (2) CENTER | (3) RIGHT | BENCH: FULL WIDTH 3 PASSENGER |
| (1) | LEFT | (2) LEFT CENTER | (6) RIGHT (3) RIGHT | BENCH: FULL WIDTH 4 PASSENGER |
| (1) | LEFT | (2) CENTER | (5) RIGHT & | BENCH: PARTIAL WIDTH, LEFT |
| | LEFT & SPACE | (2) CENTER | (5) RIGHT &SPACE | BENCH: PARTIAL WIDTH, CENTERED |
| (4) | ENTIRE V | EHICLE WIDTH | | CARGO AREA |

EXAMPLES

THE TWO FIGURES BELOW PROVIDE EXAMPLES OF THE OCCUPANT SPACE NUMBER.

PASSENGER CAR 5 PASSENGERS

VAN 12 PASSENGER CAPACITY

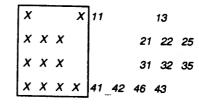

CODES FOR COLUMN F, MEASUREMENT AXIS

(X) X-AXIS (FORE & AFT)

(Y) Y-AXIS (LATERAL)

(Z) Z-AXIS (VERTICAL)

CODES FOR COLUMNS G, H, I & J, OCCUPANT & INJURY NUMBERS

| OCCUPANT | INJURY | |
|----------|--------------|---|
| NUMBER | NUMBER | CONTACT |
| (00) | (00) | NO CONTACT |
| (##) | (00) | CONTACT, NO INJURY |
| (97) | (99) | CONTACT, OCCUPANT UNKNOWN, INJURY UNKNOWN |
| (99) | (00) OR (99) | UNKNOWN IF CONTACT |
| | | |

CODES FOR COLUMN C, INTRUDING COMPONENT OR OBJECT

NOTE: DO NOT CODE OBJECTS OTHER THAN COMPONENTS OF CASE VEHICLE.

INDIVIDUAL COMPONENT

INTERNAL

- (01) INSTRUMENT PANEL
- (02) FIRE WALL
- (03) TOE PAN
- (04) FLOOR PAN
- (05) STEERING COLUMN
- (06) WINDSHIELD
- (07) WINDSHIELD HEADER
- (08) A-PILLAR
- (09) DOOR PANEL OR SIDE PANEL
- (10) WINDOW FRAME
- (11) B-PILLAR
- (12) C-PILLAR
- (13) D-PILLAR
- (14) ROOF SIDE RAILS
- (15) ROOF OR CONVERTIBLE TOP
- (16) BACKLIGHT HEADER
- (17) FRONT SEAT-BACK SURFACE/ SEAT-BACK BACK SURFACE
- (18) SECOND SEAT-BACK SURFACE SEAT-BACK BACK SURFACE
- (19) THIRD SEAT-BACK SURFACE SEAT-BACK BACK SURFACE
- (20) FOURTH SEAT-BACK SURFACE SEAT-BACK BACK SURFACE
- (21) FIFTH SEAT-BACK SURFACE SEAT-BACK BACK SURFACE
- (22) BACK PANEL/BACK DOOR SURFACE
- (23) SEAT CUSHION SURFACE/EDGE
- (24) CONSOLE
- (25) OTHER (DESCRIBE)
- (26) UNKNOWN INTERNAL SURFACES
- (28) TRANSMISSION TUNNEL (HUMP)
- (29) SIDE FOOTWELL PANEL (KICKPANEL)
- (30) SILL

EXTERNAL

- (43) HOOD
- (44) OBJECT EXTERNAL TO PASSENGER COMPARTMENT BUT PART OF CASE VEHICLE
- (45) OUTSIDE SURFACE OF CASE VEHICLE
- (46) OTHER (E.G. SPARE TIRE, JACK. DESCRIBE.)
- (49) UNKNOWN EXTERNAL OBJECT

GROUPED FOR MASSIVE INTRUSION INTO AN OCCUPANT SPACE

USE ONLY IF <u>ALL</u> THESE COMPONENTS INTRUDED INTO A SINGLE OCCUPANT SPACE.

- (50)WINDSHIELD HEADER A-PILLAR
 - ROOF SIDE RAIL
- (51)INSTRUMENT PANEL A-PILLAR DOOR PANEL
- (52)INSTRUMENT PANEL A-PILLAR WINDSHIELD HEADER
- (53)DOOR PANEL B-PILLAR ROOF RAIL
- (54)DOOR PANEL A-PILLAR ROOF RAIL
- (55)INSTRUMENT PANEL FLOOR PAN A-PILLAR DOOR FRAME
- (56)ROOF RAIL A-PILLAR B-PILLAR WINDOW FRAME
- (57)ROOF RAIL A-PILLAR B-PILLAR C-PILLAR DOOR PANEL
- (58)ROOF ROOF RAIL WINDOW FRAME DOOR PANEL
- (59)BACKLIGHT HEADER ROOF C-PILLAR THIRD SEAT-BACK

- (60)ROOF
 ROOF RAIL
 A-PILLAR
 B-PILLAR
 C-PILLAR
 WINDOW FRAME
 DOOR PANEL
 FLOOR PAN
- (61)INSTRUMENT PANEL TOE PAN WINDSHIELD HEADER A-PILLAR ROOF RAIL WINDOW FRAME DOOR PANEL ROOF
- (62)ROOF
 ROOF RAIL
 C-PILLAR
 WINDOW FRAME
 FLOOR PAN
 SECOND SEAT
 DOOR PANEL
- (63)ROOF RAIL
 ROOF
 B-PILLAR
 WINDOW FRAME
 FLOOR PAN
 DOOR PANEL
 SECOND SEAT
 FRONT SEAT
- (64)ROOF RAIL
 ROOF OR CONVERTIBLE TOP
 A-PILLAR
 B-PILLAR
 WINDOW FRAME
 WINDOW HEADER
- (65)WINDSHIELD WINDSHIELD HEADER ROOF SIDE RAIL
- (66)WINDSHIELD WINDSHIELD HEADER A-PILLAR

(98)NOT APPLICABLE

(99)UNKNOWN

| Duplicate columns 1-8 Module from the previous card. | | 1 12 | Inte | RUSION IT-5 |
|---|---|---|--|---|
| WAS THERE OCCUPANT COM (0) NO <u>DO NOT</u> ANSWER NEXT (1) YES ANSWER NEXT QUEST (9) UNKNOWN <u>SKIP PAGE</u> . | T QUESTION. <u>SKIP PAGI</u> | 13 | AS INTRUSION CATAST (0) NO <u>COMPLETE PA</u> (1) YES <u>SKIP PAGE</u> . | 14 |
| Duplicate columns 1-8 Module from the previous card. NOTE: Each line in the table below | T Format 0 11 is a separate record (ca | 12 | 1 - 12 for each completed li | ne. |
| | TRUSIONS IN THIS OF OR B, F, G, H, I, J OR C ON PAGE IT-4 | | ON ROW; FRONT TO BACK | |
| A B C | D E | F G | н і | J K |
| INTRUDING INTRUSION OCC. COMPONENT NUMBER SPACE NO. OR OBJECT | EVENT INTRUSION I | MAXIMUM MAXIMUM INTRUSION INTRUSION Y AXIS (cm) Z AXIS (cm) | OCCUPANT INJURY NUMBER NUMBER | OCCUPANT INJURY NUMBER NUMBER |
| 13-14 15-16 17-18 | 19 20-21 | 22-23 24-25 | 26-27 28-29 | 30-31 32-33 |
| 01 11 28 | 1 00 | 20 00 | 01 09 | 0000 |
| 02 13 04 | 100 | 00 15 | 00 00 | 00 00 |
| 03 L3 Q1 | | 0000 | 0201 | 00 00 |
| 041308 | 1 09 | 10000 | 0000 | 0000 |
| 0 5 <u>13 09</u> | 1 09 | 1000 | 0000 | 00 00 |
| 0 6 | <u> </u> | · | | · |
| 0 7 PAGE IF MORE THA | AN 7 INTRUSIONS. | | | |
| Duplicate columns 1-8 Module _ from the previous card. | | <u>3</u> | | |
| NOTE: IF NO SIDE DOOR INTRUSION, SKIP REMAINDER OF PAGE. SIDE DOOR INTRUSION RESULTED FROM | IF DAM DOOR INTRUSI NUMBER | INTRUSION, CODE ION DAMAGED | MPONENT RESULTE COMPONENT DAMAGED COMPONENT 2 | D IN INCREASED CODES FOR COMPONENTS |
| INTRUSION NUMBER CAUSE CODES FOR CAUSE: | A <u>O</u> <u>S</u> | <u>0</u> | 25 | (0) NONE (1) A-PILLAR (2) B-PILLAR |
| 0 5 2 13 15 (1) DIRECT IMPACT 16 18 (2) INDUCED DAMAGE 19 21 (9) UNKNOWN | B | | 29 33 | (2) S-PILLAR (3) C-PILLAR (4) LATCH/STRIKER (5) HINGES (7) OTHER: (8) NOT APPLICABLE (9) UNKNOWN |

Duplicate columns 1-8 from the previous card.

INTRUSION

IT-6

NOTE: Each line in the table below is a separate record (card). Duplicate columns 1 - 12 for each completed line.

-- ADDITIONAL PAGE --

INTRUSIONS CODE INTRUSIONS IN THIS ORDER: LEFT TO RIGHT ON ROW; FRONT TO BACK IN VEHICLES.

CODES FOR B, F, G, H, I, J ON PAGE IT-3

CODES FOR C ON PAGE IT-4

OCCUPANT CONTACT AND INJURY

| | | | | | | | | | 7.110 IIIONI | |
|--------------------|------------------|--|----------------|-------------|--|-------|---------------|------------|--------------|--------|
| A INTRUSION NUMBER | B OCC. SPACE NO. | C INTRUDING COMPONENT OR OBJECT | | | F MAXIMUM INTRUSION Y AXIS (cm) | | H OCCUPANT | INJURY | J | K |
| 13-14 | 15-16 | 17-18 | 19 | 20-21 | | | NUMBER | NUMBER | NUMBER | NUMBER |
| | | | | 20-21 | 22-23 | 24-25 | 26-27 | 28-29 | 30-31 | 32-33 |
| 0 8 | | | | | | | | | | |
| 0 9 | | | | | | | | | | |
| 1 0 | | | _ | | | | | | | |
| 11 | | | _ | | | | | | | |
| 12 | | | | | | | | <u>·</u> _ | | |
| 1 3 | | | _ | | | | | | | |
| 1 4 | | | | | | | | | | |
| 1 5 | | | | | | | | | | |
| 1 6 | | | | | | | | | | |
| 17 | | | | | | | | | | |
| 1 8 | | | | | | | | | | |
| 19 | | | | | | | | | | |
| 20 | | | . | | | | | | | |
| 21. | | | , | | | | | | | |
| 22 | | | . | | | | 14 | | | |
| 23 | | | . | | | | | | | |
| 24 | _ | | - - | | | | | | | |
| 2 5 | | | | | | | | | | |
| | | | _ | | | | | | | |

| Duplicate columns 1-8 from the previous card. | Modu | le <u> D</u> 9 10 | Format <u>0</u> <u>1</u> | ln | TERIOR DAMAGE [[| D-1 |
|---|----------|----------------------------|---|---|------------------------|---|
| co | (1 |) NO) YES) NO, and | OCCUPANT CONTACT | (4) YES, and ((8) NOT APPL (9) UNKNOW! | | |
| SIDES FRONT DOOR FRONT HARDWARE FRONT ARMREST FRONT GLASS REAR DOOR AREA REAR HARDWARE REAR ARMREST REAR GLASS ROOF SIDE RAIL B-PILLAR C-PILLAR D-PILLAR HEADLINING ROOF STRUCTURE T-ROOF/SUN ROOF OTHER: * | (C (1 |) YES | FRONT FOOT CONTROLS IGNITION KEYS REAR VIEW MIRROR SUNVISOR/FITTINGS (5) LEFT SIDE ONLY (6) RIGHT SIDE ONLY (7) BOTH SIDES WINDSHIELD TOP MOLDINGS LEFT A-PILLAR (UPPER OR LOWER) RIGHT A-PILLAR (UPPER OR LOWER) CENTER CONSOLE TRANSMISSION SELECTOR LEVER RIM, HORN, SPOKE | (8) NOT APPL | ICABLE | 1 5 1 5 1 5 1 5 1 5 1 5 5 |
| | | | | | CONSOLES VERTICAL ROOF | \$\frac{\mathbb{S}}{70} \frac{3}{71} |

^{*} MORE THAN ONE ITEM MAY BE NOTED.

| Duralicate columns 4.8 | _ | | | | · |
|--|-------------------------|---------------------|---|-------------|----------------------------|
| Duplicate columns 1-8 Module S from the previous card. | | 1 12 | SEATS | ; | ST-1 |
| FRONT SEAT TYPE OF FRONT SEAT (00) NO SEAT (01) STANDARD BENCH (02) SPLIT BACK, 50-50 (03) SPLIT BACK, DRIVER WIDE (04) SPLIT BACK, PASS. WIDE (05) BUCKET (06) CAPTAIN'S CHAIR (07) INDIV. BENCH, 50-50 (08) INDIV. BENCH, DRIVER WIDE (09) INDIV. BENCH, PASS. WIDE (09) OTHER: | DRIVER 0 5 13 14 | PASSENT 0 5 15 16 | FRONT SEAT-BACK SEAT-BACK TYPE (1) FORWARD FOLDING (2) RIGID (3) RECLINING (7) OTHER: (8) NOT APPLICABLE (9) UNKNOWN | DRIVER 3 30 | PASSENTE 31 |
| (99) UNKNOWN TYPE OF SEAT MOUNT (1) STANDARD (2) PEDESTAL (7) OTHER: (8) NOT APPLICABLE (9) UNKNOWN | <u>2</u> | <u>Z</u> | SEAT-BACK LOCK TYPE (0) NONE (1) MANUAL (2) INERTIA (3) POWER (7) OTHER: (8) NOT APPLICABLE (9) UNKNOWN | 1 32 | 33 |
| SWIVEL MECHANISM EQUIPPED (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | . 0 | 20 | LOCKS HELD (0) NO (1) YES (8) NOT APPLICABLE | 1 34 | 35 |
| ORIGINAL EQUIPMENT SEATS (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN CONTACT OF SEAT BY REAR OCCUPANT (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | <u>1</u> 21 <u>0</u> 23 | / zz O 24 | (9) UNKNOWN RECLINER MECHANISM HELD (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | 36 | 37 |
| FRONT SEAT DAMAGE (0) NONE (1) BACKREST ONLY DAMAGED (2) CUSHION ONLY DAMAGED (3) BACKREST & CUSHION DAMAGED (8) NOT APPLICABLE (9) UNKNOWN | <u>O</u> 25 | <u>Z</u> | HEAD RESTRAINT HEAD RESTRAINT TYPE (0) NONE (1) ADJUSTABLE (2) INTEGRAL (3) NOT INTEGRAL, BUT CANNOT BE REMOVED (7) OTHER: (8) NOT APPLICABLE | <u>/</u> 38 | |
| CENTER ARMREST DAMAGED (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN (8) NOT APPLICABLE (NO CENTER ARMREST) (9) UNKNOWN IF EQUIPPED | | | (9) UNKNOWN REMOVED PRE-CRASH (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | 40 | 3 |
| FRONT SEAT ROTATION (0) NONE APPARENT | 0 | 4 | ADJUSTMENT AT CRASH (1) UP (2) DOWN (8) NOT APPLICABLE (9) UNKNOWN | 2 42 | 2 43 |
| (1) FORWARD APPARENT (2) REARWARD APPARENT (3) LEFT APPARENT (4) RIGHT APPARENT (5) MULTIPLE ROTATIONS SPECIFY (8) NOT APPLICABLE (9) UNKNOWN | 28 | 29 | HEAD RESTRAINT DAMAGE (0) NONE (1) DAMAGED BUT NOT SEPARATED (2) SEPARATED (8) NOT APPLICABLE (9) UNKNOWN | <u>D</u> | <u>∂</u> 45 |

| | | | Se | ATS S | ST-2 |
|---|----------------|----------------------------|--|---------------------|--------------------|
| FRONT SEAT ADJUSTMENT | DRIVER | PASSENT | SECOND SEAT (CONT.) | | |
| SEAT ADJUSTMENT TYPE (0) NONE (RIGID) (1) MANUAL (2) POWER (7) OTHER: (8) NOT APPLICABLE (NO SEAT) (9) UNKNOWN | 2- | 1 47 | (0) NO (1) YES (7) EQUIPPED, DAMAGE UNKNOWN | C | <u>)</u> |
| ADJUSTMENT PROVIDED (1) 2-WAY (2) 4-WAY (3) 6-WAY (7) OTHER: (8) NOT APPLICABLE (9) UNKNOWN | 3 | 1 49 | (8) NOT APPLICABLE (NO CENTER ARMREST) (9) UNKNOWN IF EQUIPPED SECOND SEAT-BACK LOCKS | LEFT | Явнт |
| SEAT ADJUSTER DAMAGE (0) NONE (1) CHUCKING (FREE PLAY) (2) DEFORMED (RELEASED/JAMMED) (3) SEPARATED (7) OTHER: (8) NOT APPLICABLE (9) UNKNOWN | <u>O</u> 50 | 2 51 | FOR THE FOLLOWING, USE: (0) NO (1) YES (8) NOT APPLICABLE (9) UNKNOWN | , | 0 |
| SEAT ADJUSTER SEPARATION (0) NONE (1) SEPARATED AT FLOOR (2) SEPARATION OF ADJUSTER (3) SEPARATED AT SEAT (8) NOT APPLICABLE (9) UNKNOWN | y 52 | <u>O</u> 53 | LEFT OR CENTER, EQUIPPED LEFT OR CENTER, HELD (3) SEAT FOLDED DOWN RIGHT, EQUIPPED | 61 63 0 85 | 0 2 |
| PRE-CRASH POSITION (1) FORWARD (2) MIDDLE (3) REARWARD (8) NOT APPLICABLE (9) UNKNOWN | <u>2</u> | <u>3</u> | RIGHT, HELD (3) SEAT FOLDED DOWN THIRD SEAT | 8 67 | <u></u> |
| SECOND SEAT TYPE OF SECOND SEAT | LEFT | Rіднт | EQUIPPED BACKREST DAMAGED | <u>0</u> 8 | 0 70 8 72 |
| (0) NONE (1) NON-FOLDING (2) FOLDING (3) CAPTAIN'S CHAIR (4) JUMP SEAT (5) INTEGRAL CHILD SEAT | 2 56 | 2 57 | CUSHION DAMAGED | 71 73 73 | 72 |
| (6) LUGGAGE AREA ACCESS PANEL (9) UNKNOWN SECOND SEAT DAMAGE (0) NONE (1) BACKREST ONLY (DAMAGED OR LOOSENED) (2) CUSHION ONLY (DAMAGED OR LOOSENED) (3) BACKREST & CUSHION (DAMAGED OR LOOSENED) (4) INTEGRAL CHILD SEAT (PRIORITY CODE) (5) LUGGAGE AREA ACCESS PANEL (DAMAGED OR LOOSENED) (8) NOT APPLICABLE (9) UNKNOWN | <u>D</u> 58 | <u>0</u> 59 | VEHICLE EQUIPPED WITH REAR HEAD RESTRAINTS (0) NOT EQUIPPED (OR REMOVED) (1) EQUIPPED (2) EQUIPPED & DAMAGED (8) NOT APPLICABLE (NO REAR SEAT) (9) UNKNOWN Applies to any rear-seat position | 7 | <u>/</u> |

| Duplicate columns 1-8 from the previous card. Module A B Format 10 | 0 1 | AIRBAG | AB-1 |
|--|-------------|---|-------------|
| DRIVER SIDE LOCATION OF AIRBAG STEERING WHEEL EQUIPPED (0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED DEPLOYED (0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN | 13 | PASSENGER SIDE LOCATION OF AIRBAG INSTRUMENT PANEL (GLOVE BOX) EQUIPPED (0) NO (1) YES (4) PRIOR DEPLOYMENT NOT REINSTALLED (9) UNKNOWN IF AIRBAG EQUIPPED DEPLOYED (0) NO (1) YES (2) PARTIAL/IMPROPER DEPLOYMENT (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN | 16 |
| CONDITION OF AIRBAG STEERING WHEEL (0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPED/NOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION | <u>O</u> 15 | CONDITION OF AIRBAG INSTRUMENT PANEL (GLOVE BOX) (0) NO DAMAGE (2) SPLIT OR TORN (3) CUT DURING CRASH (4) BURNED/MELTED (5) CUT POST CRASH (6) OTHER (7) DAMAGED, CONDITION UNKNOWN (8) NOT APPLICABLE (NOT EQUIPPEDNOT DEPLOYED) (9) UNKNOWN IF EQUIPPED OR CONDITION | <u>O</u> 18 |
| | | | |
| DRIVER SIDE AIRBAG STEERING WHEEL TETHER (0) NO (1) YES (6) OTHER (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED | 19 | PASSENGER SIDE AIRBAG INSTRUMENT PANEL (GLOVE BOX) TETHER (0) NO (1) YES (6) OTHER (7) UNKNOWN IF TETHERED (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN IF AIRBAG EQUIPPED | 21 |
| MARKED BY CONTACT (0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN | 1 20 | MARKED BY CONTACT (0) NO (1) YES (8) NOT APPLICABLE (NO AIRBAG) (9) UNKNOWN | 0 2 |


AIRBAG NUMBER ON DRIVER SIDE:

RF 7 W

NOTE AND DESCRIBE ANY AIRBAG CONTACT OR DAMAGE ON DIAGRAM BELOW:

Z JENTS 6

LF 11 t

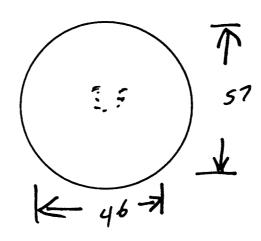


AIRBAG NUMBER ON PASSENGER SIDE:

7 F

LF 37 W

NOTE AND DESCRIBE ANY AIRBAG CONTACT OR DAMAGE ON DIAGRAM BELOW:

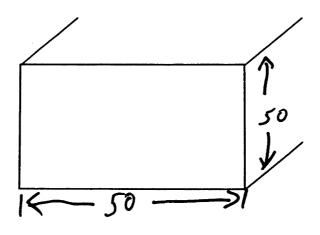

Z VENTS 2 + 9 ON

NOTE TO THE INVESTIGATOR:

THE FOLLOWING TWO SECTIONS,
OCCUPANT INFORMATION AND INJURY CLASSIFICATION,
ARE TO BE FILLED IN
FOR EACH CASE VEHICLE OCCUPANT,
WHETHER INJURED OR NOT.


IF THERE IS MORE THAN ONE OCCUPANT,
USE ADDITIONAL COPIES
OF PAGES OC-1, OC-2, OC-3,
AND IC-2 TO DESCRIBE THEM
AND ATTACH THE COPIES TO THIS REPORT.

| Duplicate columns 1-8 from the previous card. Module O C Format 0 11 | 2 12 | OCCUPANT INFORMATION | OC-1 |
|---|--------------|--|---|
| OCCUPANT IDENTIFICATION OCCUPANT NUMBER ROLE OF OCCUPANT AT 1ST IMPACT (1) MOTOR VEHICLE DRIVER (2) MOTOR VEHICLE PASSENGER (NOT DRIVER) (9) UNKNOWN | O 1/14 1/15 | PHYSICAL DESCRIPTION AGE IN YEARS (00) LESS THAN 1 YEAR (98) 98 YEARS OR OLDER (99) UNKNOWN AGE IN MONTHS (00) LESS THAN 1 MONTH (25) 25 MONTHS OR OLDER (99) UNKNOWN MASS (kg) | 3 20 2 22 2 |
| OCCUPANT POSITION ROW LOCATION (1) FRONT (2) SECOND (3) THIRD (4) FOURTH (7) OTHER: (8) EXTERNAL TO PASSENGER COMPARTMENT (E.G. BED OF PICKUP) (9) UNKNOWN | 16 | (999) UNKNOWN (135 /b) HEIGHT (cm) (999) UNKNOWN (54, 6 in) SEX (1) MALE (2) FEMALE (9) UNKNOWN | $ \begin{array}{c c} 0 & 6 \\ \hline 24 & 25 \\ \hline 1 & 6 \\ \hline 27 & 28 \\ \hline 2 \\ \hline 30 \end{array} $ |
| LATERAL LOCATION (1) LEFT (2) LEFT CENTER (3) CENTER (4) RIGHT CENTER (5) RIGHT (6) ALL (LYING ON SEAT) (8) EXTERNAL TO PASSENGER COMPARTMENT (9) UNKNOWN | 17 | MEDICAL CONDITIONS TREATMENT/MORTALITY (00) NONE (01) FIRST AID AT SCENE (02) TREATED AT HOSPITAL/CLINIC BUT NOT ADMITTED (03) HOSPITALIZED FOR OBSERVATION LESS THAN 24 HOURS (04) HOSPITALIZED OVER 24 HOURS OR FOR SIGNIFICANT TREATMENT (05) FATAL, DEAD AT SCENE (06) FATAL, DOA | 0 31 |
| (10) SITTING ON SEAT (11) SITTING ON SEAT IN ABNORMAL POSITION (E.G. FEET ON DASH, SIDEWAYS) (12) SITTING ON CONSOLE (20) ON LAP OR IN ARMS (30) STANDING ON SEAT (40) STANDING ON FLOOR (47) STANDING, EXTERNAL TO PASSENGER COMPARTMENT (50) IN BASSINET (60) IN CHILD SEAT (65) IN CHILD HARNESS | <u>/ Q</u> | (07) FATAL, DEAD WITHIN 24 HOURS (08) FATAL, DEAD 24 HOURS TO 31 DAYS LATER (09) FATAL, DEAD 31 DAYS TO 1 YEAR LATER (10) FATAL DEAD WITHIN UNKNOWN PERIOD (99) UNKNOWN INJURY SEVERITY SCORE (ISS) (99) UNKNOWN NON-IMPACT MED. CONDITIONS (0) NONE | 2 33 3 |
| (70) LYING ON SEAT (80) LYING/SITTING ON PASSENGER FLOOR (83) LYING/SITTING ON OTHER OBJECT IN PASSENGER COMPARTMENT: (85) ON CARGO FLOOR/FOLDED SEAT-BACK (87) LYING/SITTING, EXTERNAL TO PASSENGER COMPARTMENT (97) OTHER: (99) UNKNOWN | | (1) YES, TIME & TYPE UNKNOWN (2) PRE-CRASH FATAL (CLINICAL DEATH AT WHEEL) (3) PRE-CRASH NON-FATAL (E.G. PRIOR INJURY, STROKE) (4) PREGNANT (5) POST-CRASH FATAL (DROWNING) (6) POST-CRASH NON-FATAL INJURY (7) OTHER: (8) COMBINATION OF ABOVE (CIRCLE EACH) (9) UNKNOWN | 35 |

| | | OCCUPANT INFORMATION | OC-2 |
|---|-------------|--|------|
| MEDICAL CONDITIONS (CONT.) POLICE INJURY SEVERITY CODE FOR THIS OCCUPANT (0) O - NO INJURY (1) C - POSSIBLE INJURY (2) B - NON-INCAPACITATING (3) A - INCAPACITATING INJURY (4) K - FATAL (5) INJURED, SEVERITY UNKNOWN (6) DIED PRIOR TO IMPACT (7) NON-FATAL INJURY, SEVERITY UNKNOWN (9) UNKNOWN | 3 36 | CHILD SEAT TYPE (00) NONE USED (01) YES, USED (02) INTEGRAL, Chrysler Mini-van (88) NOT APPLICABLE (ADULT OR OLDER CHILD) (99) UNKNOWN CHILD SEAT MAKE/MODEL | 8 8 |
| RESTRAINT SYSTEM (0) NONE (1) LAP BELT (2) SHOULDER HARNESS ONLY (3) BOTH LAP BELT & SHOULDER HARNESS (9) UNKNOWN | 3 | EJECTION DEGREE OF EJECTION (0) NONE (1) PARTIAL (2) COMPLETE | 0 43 |
| ACTIVE RESTRAINT SYSTEM USAGE (0) NONE (AVAILABLE BUT NOT USED) (1) LAP BELT ONLY (2) SHOULDER HARNESS ONLY (3) BOTH LAP BELT & SHOULDER HARNESS (7) IMPROPER USAGE (8) NOT APPLICABLE (NONE AVAILABLE) (9) UNKNOWN | <u>O</u> 38 | (7) EJECTED, DEGREE UNKNOWN (9) UNKNOWN IF EJECTED AREA OF EJECTION (01) WINDOW, LEFT SIDE (02) WINDOW, RIGHT SIDE (03) WINDOW, REAR (04) DOOR, LEFT SIDE (05) DOOR, RIGHT SIDE (06) DOOR, RIGHT SIDE (07) WINDSHIELD (08) ROOF OR OPEN CONVERTIBLE OR | 9 2 |
| PASSIVE RESTRAINT SYSTEM (0) NONE (1) AIRBAG INSTALLED (2) PASSIVE UPPER TORSO WITH KNEE BOLSTERS (3) PASSIVE UPPER TORSO WITHOUT KNEE BOLSTERS (4) PASSIVE LAP & UPPER TORSO (5) AIRBAG INSTALLED & PASSIVE RESTRAINT (7) OTHER: (9) UNKNOWN | 39 | FROM EXTERNAL AREA (96) EJECTED AREA UNKNOWN (97) OTHER AREA: (98) NOT APPLICABLE (NOT EJECTED) (99) UNKNOWN IF EJECTED IF OCCUPANT WAS EJECTED, DESCRIBE IN DETAIL BELOW: | |
| PASSIVE RESTRAINT SYSTEM USAGE (0) SYSTEM DEFEATED (1) AIRBAG NOT DEPLOYED (2) AIRBAG DEPLOYED (3) AIRBAG NOT REINSTALLED (4) PASSIVE UPPER TORSO USED (5) PASSIVE LAP & UPPER TORSO USED (6) SYSTEM USED IN MANUAL MODE (7) IMPROPER USAGE (8) NOT APPLICABLE (NOT ORIGINALLY EQUIPPED) (9) UNKNOWN | 2-40 | HEAD RESTRAINT HEAD RESTRAINT AVAILABLE FOR THIS POSITION (0) NOT EQUIPPED OR REMOVED (1) EQUIPPED (9) UNKNOWN | 1 46 |

| | | OCCUPANT INFORMATION | OC-3 |
|--|----------|---|------|
| OCCUPANT EYEWEAR (0) NONE (1) GLASSES (2) CONTACTS (3) BOTH GLASSES AND CONTACTS (4) OTHER (8) NOT APPLICABLE (9) UNKNOWN | <u>O</u> | SOURCE OF INFORMATION INTERVIEW 1 HOSPITAL 2 AUTOPSY 3 POLICE 4 OTHER 5 LAY CORONER/EXTERNAL EXAM 7 COMBINATION OF ABOVE (CIRCLE) 8 NOT APPLICABLE 9 UNKNOWN | 7 48 |

INDICATE LOCATION OF INJURIES.

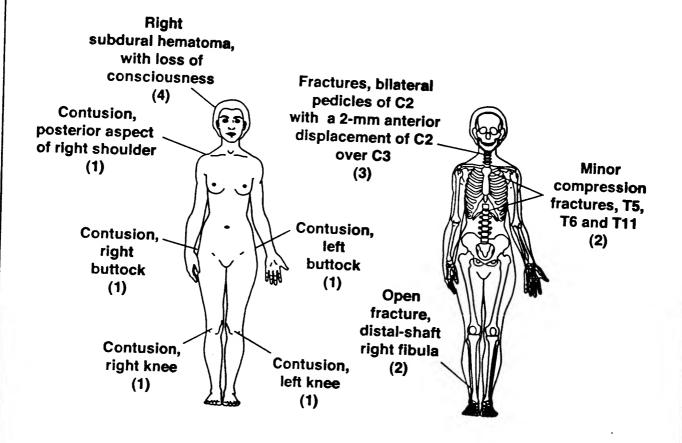

Duplicate columns 1-8 from the previous card.

Module 1 C Format 0 1

NOTE: Each line in the table below is a separate record (card).

Duplicate columns 1 - 12 for each completed line.


OCCUPANT INJURY CLASSIFICATION

| | | | | | | PRIM | ARY C | OIC | | A | ssoc | IATED | OIC | | COMMENTS |
|---------------------------------|---------------|-------------------------------|---------------------------------------|--|---------------|----------|----------|----------------|-------------|---------------|----------|-------------|---------------|-------------|----------|
| OCCUPANT NUMBER | INJURY NUMBER | PROBAL START I IN 1ST (| BILITY (HOF WITH MOST CONTACT A | IN ORDER OF RIZONTALLY) . PROBABLE REA COLUMN. BLE CONTACT | BODY REGION 1 | ASPECT Q | LESION 3 | SYSTEM/ORGAN 4 | SEVERITY 15 | BODY REGION 1 | ASPECT O | LESION 3 | SYSTEMORGAN & | SEVERITY 10 | |
| 13-14 | 15-16 | 17-18 | 19-20 | COMMENTS | 21 | 22 | 23 | 24 | 25 | 26 | 27 | 28 | 29 | 30 | |
| 01 | 01 | 68 | | | H | R | U | B | 4 | _ | | | | _ | |
| ↑ | 02 | 20 | 40 | | <u>N</u> | <u>P</u> | 2 | <u>V</u> | <u>3</u> | _ | _ | _ | | _ | |
| | 03 | 29 | 40 | | <u>s</u> | <u></u> | <u></u> | I | 1 | _ | | _ | _ | _ | |
| | 04 | 20 | 40 | | <u>B</u> | <u>5</u> | F | <u>s</u> | 2 | _ | _ | _ | _ | _ | |
| | 05 | 27 | 40 | | 2 | R | <u></u> | I | 1 | _ | _ | _ | | _ | |
| | 06 | 27 | 40 | | <u>P</u> | <u>८</u> | <u>c</u> | I | 1 | | | _ | _ | _ | |
| | <u>o 7</u> | 99 | | | K | <u>K</u> | <u>c</u> | Į | 1 | _ | | _ | _ | | |
| | 08 | 99 | | | K | <u></u> | <u>c</u> | Į | 1 | _ | | _ | _ | | |
| "Occupant Number" for each line | 09 | 38 | | Transmission tunnel | <u>L</u> | K | E | <u>s</u> | 2 | _ | | | _ | _ | |
| mber fo | | | | | _ | | | | _ | _ | | | | _ | |
| upent Nr | | | | | _ | | _ | _ | _ | _ | _ | _ | _ | _ | |
| • | | | , | | _ | _ | _ | _ | _ | | _ | _ | | _ | |
| - Duplicat | | | | | | _ | _ | | _ | _ | _ | _ | _ | _ | |
| | | | | | _ | | _ | _ | | _ | _ | | | | |
| | | | | | | _ | _ | _ | | | | _ | _ | - | |
| | | | | | _ | _ | _ | _ | | | | | _ | - | |
| | | | | | _ | | _ | _ | _ | | _ | _ | | - | |
| | | | | | | | _ | | _ | _ | _ | _ | _ | | |

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

| FRO | | DOUBLE OCCUPA | 4N I | CONTACT |
|--------------|--|-------------------|-------|--|
| I NO | NT OF PASSENGER COMPARTMENT | Sides | : | |
| ` | 10) SUNVISOR, FITTING(S) &/OR TOP MOLDING 12) WINDSHIELD | (20 | | SURFACE OF SIDE INTERIOR |
| , | 12) WINDSHIELD | (19 | 9) | HARDWARE ON SIDE OR DOOR |
| 6 | 05) INSTRUMENT PANEL (SPECIFIC AREA UNICHOUSE | (13 | • | ARMREST ON SIDE OR DOOR |
| • | 05) INSTRUMENT PANEL (SPECIFIC AREA UNKNOWN) 54) UPPER INSTRUMENT PANEL (X) | (24 | • | COAT HOOK |
| | 55) MIDDLE INSTRUMENT PANEL (Y) | · | • | |
| | 56) LOWER INSTRUMENT PANEL (Z) | (22 | 2) V | /INDOW GLASS (SIDE) |
| - | 31) ASH TRAY (INSTRUMENT PANEL) | (21 | i) w | (INDOW FRAMES (SIDE) |
| • | 2) GLOVE COMPARTMENT AREA | | - | (0,02) |
| • | 17) AIRBAG (ACRS) COMPARTMENT DOOR/COVER | (26 |) R | OOF SIDE RAIL |
| ` | THE PLANT OF THE PROPERTY DOUBLE | | | PILLAR |
| (5 | 7) BENEATH INSTRUMENT PANEL | (15) |) B | PILLAR |
| • | 3) PARCEL TRAY | (16) |) C | PILLAR |
| (4 | 8) KNEE RESTRAINT | (17) |) D. | PILLAR |
| (8 | 6) VERTICAL CONSOLE | _ | | |
| | | FLOOR | | |
| (2 | 8) FOOT CONTROLS (INCL. PARKING BRAKE PEDAL) | (40) | | OOR |
| | • | (27) | C | ONSOLE ON FLOOR OR BETWEEN SEATS |
| (0: | 9) STEERING ASSEMBLY (SPECIFIC AREA UNKNOWN) | (44) | 11 | MANSMISSION LEVER ON FLOOR OR COMEOUR |
| (65 | b) STEERING WHEEL | (85) | P P | HKING BRAKE HANDLE ON FLOOR OR COMEOUR |
| (66 | | (28) | r C | OT CONTHOLS (INCL. PARKING BRAKE PEDAL) |
| (59 | | (91) | KK | CKPANEL |
| | | Poor | | |
| (03 | | Roof | - | 05.05.00 |
| (82 |) INSTRUMENT(S) | (25) | HC | OF OR CONVERTIBLE TOP |
| (83 | | (10) | 50 | NVISOR, FITTING(S) &/OR TOP MOLDING |
| (84 | PARKING BRAKE HANDLE IN FRONT | (26) (24) | - | OF SIDE RAIL |
| (67 | | (18) | | AT HOOK |
| (06) | | , (39) | | ME LIGHT |
| (04) | | (68) | BO | CKLIGHT HEADER |
| (01) | THE THE STATE OF T | (69) | BO. | OF MOUNTED CONTROLS/CONSOLE |
| (08) (58) | | (00) | | CL DAN |
| (68) | | EXTERIO | R SI | JRFACE OF CASE VEHICLE |
| (00) | ROOF MOUNTED CONTROLS/CONSOLES | (37) | OU | TSIDE SURFACE OF CASE VEHICLE |
| REAR | • | , | (SP | ECIFIC AREA UNKNOWN) |
| | SURFACE OF REAR INTERIOR | (35) | , | HOOD OF CASE VEHICLE |
| (23) | REAR WINDOW | (60) | _ | EXTERIOR OF CASE VEHICLE (E.G. |
| | REAR WINDOW HEADER | • • | • | OUTSIDE MIRRORS, ANTENNA, TRIM) |
| (50) | REAR SEAT CUSHION & BACK | (62) | | EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE |
| ` , | THE WASHINGTON & BACK | (63) | | TRUNK LID OF CASE VEHICLE |
| INTERIO | R-GENERAL | (64) | | TIRES OF CASE VEHICLE |
| (11) | TRANSMISSION SELECTION LEVER // OCATION LINES | _ | | |
| (59) | MANSMISSION LEVER ON STEFRING COLUMN | BEYOND | CAS | E VEHICLE BOUNDARY |
| (44) | I HANSMISSION LEVER ON FLOOR OR COMES, F | (36) | ARE | A EXTERIOR TO CAR (SPECIFIC AREA LINE) |
| (07) | PARKING BRAKE HANDLE (LOCATION LINKNOWN) | (10) | | HOOD OF CHER VEHICLE |
| (84) | PARKING BRAKE HANDLE IN FRONT | (71) | | OTHER VEHICLE EXTERIOR HARDWARE (E.C. |
| (85) | PARKING BRAKE HANDLE ON FLOOR OR CONSOLE | | | OUTSIDE MIRRORS, ANTENNA TOWN |
| (28) | FOOT CONTROLS (INCL. PARKING BRAKE PEDAL) | (73) | | EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE |
| | | (74) | | I CADLIGHT OR FRONT GRILL OF OTHER VEH |
| (29) | FRONT SEAT-BACK(S) | (75) | | LUCIAN OF OTHER VEHICLE |
| | FRONT SEAT CUSHION | (76) (77) | | OUTSIDE SURFACE OF OTHER VEHICLE |
| (50) | | (77) (78) | | TIRES OF OTHER VEHICLE |
| | ARMREST ON SEAT | (78) (79) | | GROUND |
| (89) | UNDER SEAT BOTTOM | (80) | | WATER |
| (22) | DECTO AND OVERTIME | (00) | , | EXTERIOR OBJECT (NOT VEHICLE, GROUND, |
| (33) | RESTRAINT SYSTEM HARDWARE | | • | OR WATER. PLEASE DESCRIBE.) |
| (34) (87) | RESTRAINT SYSTEM WEBBING | PENETRAT | TING | OR IECTS |
| (67) (47) | AIR CUSHION SKIN (AIRBAG) | | | ER VEHICLE |
| (46) | AIRBAG (ACRS) COMPARTMENT DOOR/COVER AIRBAG GAS | | | CTS (DESCRIBE) |
| | KNEE RESTRAINT | (· -) | | - · · · · · · · · · · · · · · · · · · · |
| | HEAD RESTRAINT | MISCELLAI | NEO | I S |
| | CHILD SEAT RESTRAINTS | (00) | NO C | ONTACT (INVALID FIELD FORM CODE) |
| | CHILD SEAT | (38) | OTHE | R (E.G. FIRE. DESCRIBE) |
| | INTERIOR LOOSE OBJECT | (90) 8 | SPAR | E TIRE |
| | OTHER OCCUPANT(S) | (96) 1 | NDUC | CED |
| | NTERNAL FLYING GLASS (FROM ANY SOURCE) | (97) E | EJECT | FED, UNKNOWN CONTACT |
| (41) | JNKNOWN INTERIOR SURFACE | (98) 11 | MPAC | T FORCE, "WHIPLASH" |
| | | H | MPE | REXTENSION/COMPRESSION |

(99) UNKNOWN AREA OF CONTACT

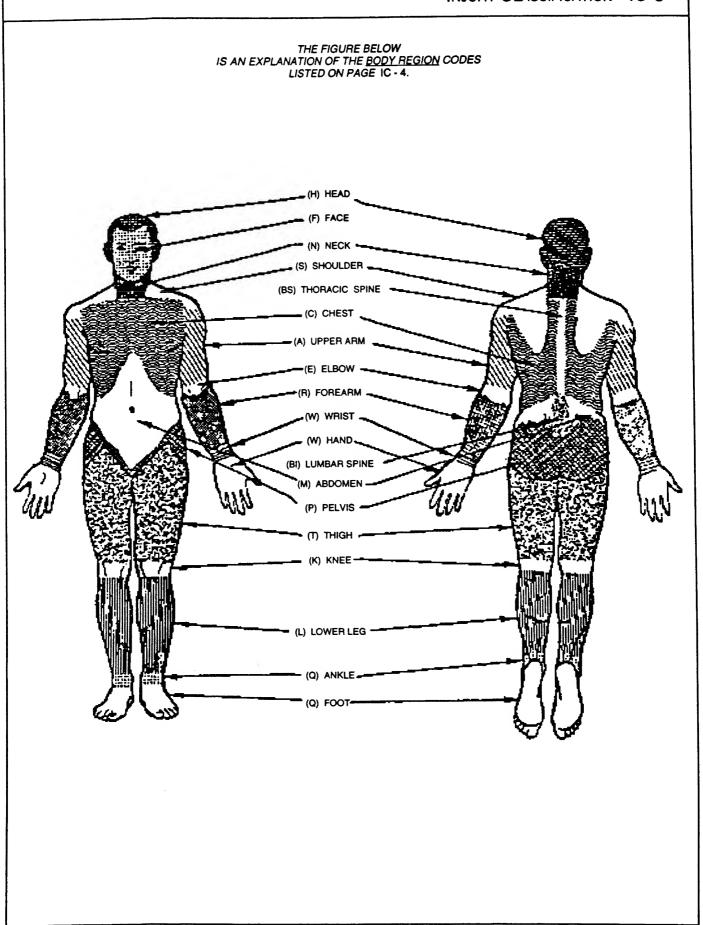

INJURY CLASSIFICATION IC-4

CODES FOR OCCUPANT INJURY CLASSIFICATION (OIC)

| - | | |
|---|------|--------|
| 1 | BODY | REGION |

- (H) HEAD/SKULL
- (F) FACE
- (N) NECK
- (S) SHOULDER
- (X) UPPER EXTREMITIES
- (A) ARM (UPPER)
- (E) ELBOW
- (R) FOREARM
- (W) WRIST/HAND
- (C) CHEST
- (M) ABDOMEN
- (B) BACK
- (P) PELVIC/HIP
- (Y) LOWER EXTREMITIES
- (T) THIGH
- (K) KNEE
- (L) LEG (LOWER)
- (Q) ANKLE/FOOT
- (O) WHOLE BODY
- (U) UNKNOWN

3 LESION

- (L) LACERATION
- (C) CONTUSION
- (A) ABRASION
- (F) FRACTURE
- (P) PERFORATION, PUNCTURE
- (K) CONCUSSION
- (V) AVULSION
- (R) RUPTURE
- (S) SPRAIN
- (D) DISLOCATION
- (N) CRUSH
- (M) AMPUTATION
- (B) BURN
- (G) DETACHMENT, SEPARATION
- (Z) FRACTURE AND DISLOCATION
- (T) STRAIN
- (E) TOTAL SEVERANCE, TRANSECTION
- (O) OTHER
- (U) UNKNOWN

4 SYSTEM/ORGAN

- (S) SKELETAL
- (V) VERTEBRAE
- (J) JOINTS
- (D) DIGESTIVE
- (L) LIVER
- (N) NERVOUS SYSTEM
- (B) BRAIN
- (C) SPINAL CORD
- (E) EARS
- (O) EYES
- (A) ARTERIES
- (H) HEART
- (Q) SPLEEN
- (G) UROGENITAL
- (K) KIDNEYS
- (R) RESPIRATORY
- (P) PULMONARY/LUNGS
- (M) MUSCLES
- (T) THYROID, OTHER ENDOCRINE GLAND
- (I) INTEGUMENTARY (SKIN)
- (W) ALL SYSTEMS IN REGION
- (U) UNKNOWN

2 ASPECT

- (R) RIGHT
- (L) LEFT
- (B) BILATERAL
- (C) CENTRAL
- (A) ANTERIOR/FRONT
- (P) POSTERIOR/BACK
- (S) SUPERIOR/UPPER
- (I) INFERIOR/LOWER
- (W) WHOLE REGION
- (U) UNKNOWN

SEVERITY 5 SYSTEM/ORGAN 4 LESION 5 ASPECT 0 BODY REGION 1

SEVERITY (OR "AIS", ABBREVIATED INJURY SCALE)

- (0) NONE
- (1) MINOR
- (2) MODERATE
- (3) SERIOUS
- (4) SEVERE
- (5) CRITICAL
- (6) MAXIMUM
- (9) UNKNOWN


| Duplicate columns 1-8 Module O C Format 0 11 | 12 | Occupant Information (| OC-1 |
|---|-------|---|--------------|
| OCCUPANT IDENTIFICATION | | Physical Description | |
| OCCUPANT NUMBER | 01 | AGE IN YEARS (00) LESS THAN 1 YEAR | 1 20 |
| ROLE OF OCCUPANT AT 1ST IMPACT | | (98) 98 YEARS OR OLDER (99) UNKNOWN | 20 |
| (1) MOTOR VEHICLE DRIVER (2) MOTOR VEHICLE PASSENGER (NOT DRIVER) (9) UNKNOWN | 7 15 | AGE IN MONTHS (00) LESS THAN 1 MONTH (25) 25 MONTHS OR OLDER (99) UNKNOWN | 2 3 |
| | | MASS (kg) | |
| OCCUPANT POSITION | | (999) UNKNOWN (55 16) | 0 Z 24 25 |
| ROW LOCATION | . | HEIGHT (cm) | |
| (1) FRONT (2) SECOND | 16 | (999) UNKNOWN (4 ft, 0 is) | 1 2 |
| (3) THIRD (4) FOURTH | | SEX | |
| (7) OTHER: | | (1) MALE (2) FEMALE (9) UNKNOWN | 30 |
| LATERAL LOCATION | | MEDICAL CONDITIONS | |
| (1) LEFT | 5 | TREATMENT/MORTALITY | 0 |
| (2) LEFT CENTER | 5 | (00) NONE (01) FIRST AID AT SCENE | 0 |
| (3) CENTER | | (02) TREATED AT HOSPITAL/CLINIC | |
| (4) RIGHT CENTER (5) RIGHT | | BUT NOT ADMITTED (03) HOSPITALIZED FOR OBSERVATION | |
| (6) ALL (LYING ON SEAT) | | LESS THAN 24 HOURS | |
| (8) EXTERNAL TO PASSENGER COMPARTMENT | | (04) HOSPITALIZED OVER 24 HOURS OR FOR SIGNIFICANT TREATMENT | |
| (9) UNKNOWN | | (05) FATAL, DEAD AT SCENE | |
| | | (06) FATAL, DOA (07) FATAL, DEAD WITHIN 24 HOURS | |
| POSTURE | | (08) FATAL, DEAD 24 HOURS TO | |
| (10) SITTING ON SEAT | 97 | 31 DAYS LATER | |
| (11) SITTING ON SEAT IN ABNORMAL | 18 19 | (09) FATAL, DEAD 31 DAYS TO 1 YEAR LATER | |
| POSITION (E.G. FEET ON DASH, | | (10) FATAL DEAD WITHIN UNKNOWN | |
| SIDEWAYS) (12) SITTING ON CONSOLE | | PERIOD (99) UNKNOWN | |
| (20) ON LAP OR IN ARMS | | ` ' | |
| (30) STANDING ON SEAT (40) STANDING ON FLOOR | | INJURY SEVERITY SCORE (ISS) | |
| (47) STANDING, EXTERNAL TO PASSENGER COMPARTMENT | | (99) UNKNOWN | 0 |
| (50) IN BASSINET | | | 33 |
| (60) IN CHILD SEAT (65) IN CHILD HARNESS | | NON-IMPACT MED. CONDITIONS | |
| (70) LYING ON SEAT | İ | (0) NONE (1) YES, TIME & TYPE UNKNOWN | 7 |
| (80) LYING/SITTING ON PASSENGER FLOOR | 1 | (2) PRE-CRASH FATAL (CLINICAL | 35 |
| (83) LYING/SITTING ON OTHER | | DEATH AT WHEEL) (3) PRE-CRASH NON-FATAL (E.G. | |
| OBJECT IN PASSENGER | | PRIOR INJURY, STROKE) | |
| (85) ON CARGO FLOOR/FOLDED | | (4) PREGNANT (5) POST-CRASH FATAL (DROWNING) | |
| SEAT-BACK | | (6) POST-CRASH NON-FATAL INJURY | |
| (87) LYING/SITTING, EXTERNAL TO PASSENGER COMPARTMENT. | ſ | (7) OTHER: <u>Multiple bighth defects</u> (8) COMBINATION OF ABOVE | |
| (97) OTHER: In handingsond | | (CIRCLE EACH) | |
| (99) UNKNOWN position seat | | (9) UNKNOWN | |


| | | Occupant Information (| OC-2 |
|--|----------|--|------|
| MEDICAL CONDITIONS (CONT.) | <u> </u> | CHILD SEAT TYPE | i |
| POLICE INJURY SEVERITY CODE FOR THIS OCCUPANT | | (00) NONE USED (01) YES, USED (02) INTEGRAL, Chrysler Mini-van | 0 - |
| (0) O - NO INJURY (1) C - POSSIBLE INJURY | , | (88) NOT APPLICABLE (ADULT OR OLDER CHILD) (99) UNKNOWN | |
| (2) B - NON-INCAPACITATING (3) A - INCAPACITATING INJURY (4) K - FATAL | 36 | CHILD SEAT MAKE/MODEL | |
| (5) INJURED, SEVERITY UNKNOWN (6) DIED PRIOR TO IMPACT (7) NON-FATAL INJURY, | | "Tumble Form" | |
| SEVERITY UNKNOWN (9) UNKNOWN | | <u>Position</u> seat | |
| RESTRAINT SYSTEM | | | |
| ACTIVE RESTRAINT SYSTEM | | EJECTION | |
| (0) NONE (1) LAP BELT (2) SHOULDER HARNESS ONLY | 37 | DEGREE OF EJECTION | |
| (3) BOTH LAP BELT & SHOULDER HARNESS | 3/ | (0) NONE | |
| (9) UNKNOWN | | (1) PARTIAL (2) COMPLETE (7) EJECTED, DEGREE UNKNOWN | 43 |
| ACTIVE RESTRAINT SYSTEM USAGE | l . | (9) UNKNOWN IF EJECTED AREA OF EJECTION | |
| (0) NONE (AVAILABLE BUT NOT USED) (1) LAP BELT ONLY | 7 | (01) WINDOW, LEFT SIDE | 0 |
| (2) SHOULDER HARNESS ONLY (3) BOTH LAP BELT & | 38 | (02) WINDOW, RIGHT SIDE | 4. |
| SHOULDER HARNESS | | (03) WINDOW, REAR (04) DOOR, LEFT SIDE | |
| (7) IMPROPER USAGE (8) NOT APPLICABLE (NONE AVAILABLE) | | (05) DOOR, RIGHT SIDE (06) DOOR, REAR OR TAILGATE | - |
| (9) UNKNOWN | | (07) WINDSHIELD (08) ROOF OR OPEN CONVERTIBLE OR | |
| PASSIVE RESTRAINT SYSTEM | | FROM EXTERNAL AREA (96) EJECTED AREA UNKNOWN (97) OTHER AREA: | |
| (0) NONE (1) AIR BAG INSTALLED | | (98) NOT APPLICABLE (NOT EJECTED) | |
| (2) PASSIVE UPPER TORSO | | (99) UNKNOWN IF EJECTED | |
| WITH KNEE BOLSTERS (3) PASSIVE UPPER TORSO | 30 | IF OCCUPANT WAS EJECTED, DESCRIBE | |
| WITHOUT KNEE BOLSTERS (4) PASSIVE LAP & UPPER TORSO | | IN DETAIL BELOW: | |
| (5) AIR BAG INSTALLED & | | | • |
| PASSIVE RESTRAINT (7) OTHER: | | | - |
| (9) UNKNOWN | | | _ |
| PASSIVE RESTRAINT SYSTEM USAGE | | | |
| (0) SYSTEM DEFEATED (1) AIR BAG NOT DEPLOYED | 2 | ** | • |
| (2) AIR BAG DEPLOYED (3) AIR BAG NOT REINSTALLED | | | |
| (4) PASSIVE UPPER TORSO USED | * | | |
| (5) PASSIVE LAP & UPPER TORSO USED (6) SYSTEM USED IN MANUAL MODE | | HEAD RESTRAINT | |
| (7) IMPROPER USAGE (8) NOT APPLICABLE (NOT ORIGINALLY | ļ | HEAD RESTRAINT AVAILABLE | |
| EQUIPPED) | İ | FOR THIS POSITION | |
| (9) UNKNOWN | | (0) NOT EQUIPPED OR REMOVED (1) EQUIPPED | |
| | | (9) UNKNOWN | 45 |

| | | OCCUPANT INFORMATION (| DC-3 |
|--|---|---|-------------|
| OCCUPANT EYEWEAR (0) NONE (1) GLASSES (2) CONTACTS (3) BOTH GLASSES AND CONTACTS (4) OTHER (8) NOT APPLICABLE (9) UNKNOWN | Q | SOURCE OF INFORMATION INTERVIEW HOSPITAL AUTOPSY (3) POLICE (4) OTHER (5) LAY CORONER/EXTERNAL EXAM (7) COMBINATION OF ABOVE (CIRCLE) (8) NOT APPLICABLE (9) UNKNOWN | Z 49 |

OCCUPANT INFORMATION OC-4

INDICATE LOCATION OF INJURIES.

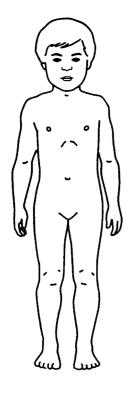

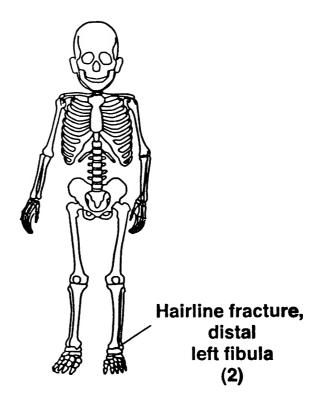

INJURY CLASSIFICATION IC-1

Duplicate columns 1-8 from the previous card.

Module <u>I</u> <u>C</u> Format <u>0</u> <u>1</u> 12

NOTE: Each line in the table below is a separate record (card).

Duplicate columns 1 - 12 for each completed line.

OCCUPANT INJURY CLASSIFICATION

| | | | | | | PRIM | ARY C | OIC | | AS | SOCI | ATED | OIC | | COMMENTS |
|-----------------------|---------------|-------------------------------|--|--|---------------|----------|-----------|---------------|-------------|---------------|----------|----------|---------------|-------------|----------|
| OCCUPANT NUMBER | INJURY NUMBER | PROBAE START V IN 1ST C | BILITY (HOR WITH MOST CONTACT AI | IN ORDER OF IZONTALLY). PROBABLE REA COLUMN. ILE CONTACT | BODY REGION 1 | ASPECT 2 | LESION C3 | SYSTEMORGAN & | SEVERITY 15 | BODY REGION 1 | ASPECT Q | LEBION 3 | SYSTEMOROWN 4 | SEVERITY 15 | |
| 13-14 | 15-16 | 17-18 | 19-20 | COMMENTS | 21 | 22 | 23 | 24 | 25 | 26 | 27 | 28 | 29 | 30 | |
| 02 | 01 | 02 | | | L | <u>L</u> | E | <u>5</u> | 7 | _ | | _ | _ | _ | |
| 1 | | | | | _ | _ | | | _ | _ | _ | | _ | | |
| | | | | | _ | _ | | | | _ | | | | | |
| | | | | | | | | | | | | | | | |
| | | | | | | | | | _ | _ | _ | _ | _ | | |
| | | | | | _ | | | _ | _ | _ | _ | _ | | - | |
| | | | | | | | | _ | _ | _ | | _ | | - | |
| | | | | | _ | _ | | _ | _ | _ | _ | _ | _ | - | |
| | | | | | | _ | _ | _ | _ | _ | _ | _ | _ | _ | |
| ed In | | | | | | | | _ | _ | _ | _ | | | _ | |
| | | | | | _ | | _ | _ | _ | _ | _ | | | | |
| "Occupent Number" for | | | | | | | | | | | Ē | | | | |
| Occupa | | | | | _ | _ | | _ | _ | - | | | | | |
| 2 | | | | | _ | _ | _ | _ | _ | - | _ | _ | | | |
| Duptk | | | | | _ | _ | _ | _ | _ | - | _ | | _ | _ | |
| | | | | | _ | _ | _ | _ | _ | - | _ | _ | _ | _ | |
| | | | | | _ | _ | | _ | _ | _ | _ | _ | | _ | |
| | | | | | _ | _ | _ | _ | _ | _ | | _ | _ | | |
| | | | | | | _ | _ | | | | | | | | |
| | | | | | _ | | | _ | | _ | _ | _ | _ | | |
| | | | | | _ | | _ | _ | - | - | _ | _ | | _ | |

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT


| FRONT | OF PASSENGER COMPARTMENT | SIDES | |
|--------------|--|--------------|--|
| (10) | SUNVISOR, FITTING(S) &/OR TOP MOLDING | (20) | SURFACE OF SIDE INTERIOR |
| (12) | | (19) | HARDWARE ON SIDE OR DOOR |
| · · - • | | (13) | ARMREST ON SIDE OR DOOR |
| (05) | INSTRUMENT PANEL (SPECIFIC AREA UNKNOWN) | (24) | COAT HOOK |
| (54) | UPPER INSTRUMENT PANEL (X) | , , | |
| (55) | MIDDLE INSTRUMENT PANEL (Y) | (22) | WINDOW GLASS (SIDE) |
| (56) | LOWER INSTRUMENT PANEL (Z) | (21) | WINDOW FRAMES (SIDE) |
| (81) | ASH TRAY (INSTRUMENT PANEL) | | |
| (02) | GLOVE COMPARTMENT AREA | | ROOF SIDE RAIL |
| (47) | AIRBAG (ACRS) COMPARTMENT DOOR/COVER | (14) | A-PILLAR |
| | | , · · | 8-PILLAR |
| (57) | BENEATH INSTRUMENT PANEL | · · - / | C-PILLAR |
| (53) | PARCEL TRAY | (17) | D-PILLAR |
| (48) | KNEE RESTRAINT VERTICAL CONSOLE | F: 000 | |
| (86) | VENTIOAL CONSOLE | FLOOR | E cop |
| (28) | FOOT CONTROLS (INCL PARKING BRAKE PEDAL) | (40) | |
| (20) | FOOT CONTINUES (MOLE FAMILIAND BISARE FEDAL) | (27) (44) | CONSOLE ON FLOOR OR BETWEEN SEATS TRANSMISSION LEVER ON FLOOR OR CONSOLE |
| (09) | STEERING ASSEMBLY (SPECIFIC AREA UNKNOWN) | | PARKING BRAKE HANDLE ON FLOOR OR CONSOLE |
| (65) | STEERING WHEEL | | FOOT CONTROLS (INCL. PARKING BRAKE PEDAL) |
| (66) | STEERING WHEEL COLUMN | (91) | |
| (59) | TRANSMISSION LEVER ON COLUMN | (-,) | |
| , , | | Roof | |
| (03) | HARDWARE ITEM (SPECIFIC AREA UNKNOWN) | (25) | ROOF OR CONVERTIBLE TOP |
| (82) | INSTRUMENT(S) | (10) | SUNVISOR, FITTING(S) &/OR TOP MOLDING |
| (83) | CONTROL KNOB(S) & LEVER(S) (FRONT) | (26) | ROOF SIDE RAIL |
| (84) | PARKING BRAKE HANDLE IN FRONT | (24) | COAT HOOK |
| (67) | IGNITION KEY | | DOME LIGHT |
| (06) | MIRROR | | BACKLIGHT HEADER |
| (04) | HEATER OR AIR CONDITIONING DUCTS | · • | ROOF MOUNTED CONTROLS/CONSOLE |
| (01) | AIR CONDITIONING OR VENTILATION OUTLET(S) | (69) | ROLL BAR |
| (08) (58) | RADIO <i>(BUILT IN)</i> ADD-ON TAPE DECK, RADIO, A/C | Evenic | OR SURFACE OF CASE VEHICLE |
| (68) | ROOF MOUNTED CONTROLS/CONSOLES | | OUTSIDE SURFACE OF CASE VEHICLE |
| (00) | THE STATE OF THE S | (37) | (SPECIFIC AREA UNKNOWN) |
| REAR | | (35) | HOOD OF CASE VEHICLE |
| (88) | SURFACE OF REAR INTERIOR | (60) | EXTERIOR OF CASE VEHICLE (E.G. |
| | REAR WINDOW | (00) | OUTSIDE MIRRORS, ANTENNA, TRIM) |
| (39) | REAR WINDOW HEADER | (62) | EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE |
| (50) | REAR SEAT CUSHION & BACK | (63) | TRUNK LID OF CASE VEHICLE |
| | | (64) | TIRES OF CASE VEHICLE |
| | R-GENERAL | | |
| | TRANSMISSION SELECTION LEVER (LOCATION UNK.) | | CASE VEHICLE BOUNDARY |
| (59) | TRANSMISSION LEVER ON STEERING COLUMN | (36) | AREA EXTERIOR TO CAR (SPECIFIC AREA UNK.) |
| (44) | TRANSMISSION LEVER ON FLOOR OR CONSOLE | (70) | HOOD OF OTHER VEHICLE |
| | PARKING BRAKE HANDLE (LOCATION UNKNOWN) | (71) | OTHER VEHICLE EXTERIOR HARDWARE (E.G. |
| (84) | PARKING BRAKE HANDLE IN FRONT | | OUTSIDE MIRRORS, ANTENNA, TRIM) |
| (85) (28) | PARKING BRAKE HANDLE ON FLOOR OR CONSOLE FOOT CONTROLS (INCL. PARKING BRAKE PEDAL) | (73) | EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE |
| (20) | FOOT CONTINUES (INCL. FARRING BRAKE PEDAL) | (74) | HEADLIGHT OR FRONT GRILL OF OTHER VEH. |
| (29) | FRONT SEAT-BACK(S) | (75) | TRUNK OF OTHER VEHICLE |
| (51) | FRONT SEAT CUSHION | (76) | OUTSIDE SURFACE OF OTHER VEHICLE TIRES OF OTHER VEHICLE |
| | REAR SEAT CUSHION & BACK | (77) (78) | GROUND |
| (49) | ARMREST ON SEAT | (79) (79) | WATER |
| (89) | UNDER SEAT BOTTOM | (80) | EXTERIOR OBJECT (NOT VEHICLE, GROUND, |
| , , | | (00) | OR WATER. PLEASE DESCRIBE.) |
| (33) | RESTRAINT SYSTEM HARDWARE | | or writer a reproduct beoor not. |
| (34) | RESTRAINT SYSTEM WEBBING | PENETR | ATING OBJECTS |
| (87) | AIR CUSHION SKIN (AIRBAG) | | OTHER VEHICLE |
| (47) | AIRBAG (ACRS) COMPARTMENT DOOR/COVER | | OBJECTS (DESCRIBE) |
| (46) | AIRBAG GAS | , -, | |
| (48) | KNEE RESTRAINT | | ANEOUS |
| 1/ | HEAD RESTRAINT | | NO CONTACT (INVALID FIELD FORM CODE) |
| (42) | CHILD SEAT RESTRAINTS | | OTHER (E.G. FIRE. DESCRIBE) |
| • • | CHILD SEAT INTERIOR LOOSE OBJECT | | SPARE TIRE |
| (31) | OTHER OCCUPANT(S) | (96) | |
| | INTERNAL FLYING GLASS (FROM ANY SOURCE) | (97) | |
| | UNKNOWN INTERIOR SURFACE | (98) | |
| (31) | | (99) | HYPEREXTENSION/COMPRESSION UNKNOWN AREA OF CONTACT |
| | | (00) | UNITED OF CONTINUE |


| Duplicate columns 1-8 from the previous card. Module O C Format 0 11 | | Occupant Information OC-1 | | | | | | | |
|--|------|---|-------------|--|--|--|--|--|--|
| OCCUPANT IDENTIFICATION | | Physical Description | | | | | | | |
| OCCUPANT NUMBER | 03 | AGE IN YEARS (00) LESS THAN 1 YEAR (98) 98 YEARS OR OLDER | 1 20 3 | | | | | | |
| ROLE OF OCCUPANT AT 1ST IMPACT | 2 | (99) UNKNOWN | | | | | | | |
| (1) MOTOR VEHICLE DRIVER (2) MOTOR VEHICLE PASSENGER (NOT DRIVER) (9) UNKNOWN | 15 | AGE IN MONTHS (00) LESS THAN 1 MONTH (25) 25 MONTHS OR OLDER (99) UNKNOWN | 2 : | | | | | | |
| | | MASS (kg) | | | | | | | |
| OCCUPANT POSITION | | (999) UNKNOWN (130 16.) | 05 24 25 | | | | | | |
| ROW LOCATION | | HEIGHT (cm) | | | | | | | |
| (1) FRONT (2) SECOND (3) THIRD | 2 16 | (999) UNKNOWN (5ft, 8in) | 27 28 | | | | | | |
| (4) FOURTH (7) OTHER: (8) EXTERNAL TO PASSENGER COMPARTMENT (E.G. BED OF PICKUP) (9) UNKNOWN | | SEX (1) MALE (2) FEMALE (9) UNKNOWN | 20 | | | | | | |
| | | MEDICAL CONDITIONS | | | | | | | |
| LATERAL LOCATION | - | TREATMENT/MORTALITY | | | | | | | |
| (1) LEFT (2) LEFT CENTER (3) CENTER (4) RIGHT CENTER | 5 17 | (00) NONE (01) FIRST AID AT SCENE (02) TREATED AT HOSPITAL/CLINIC BUT NOT ADMITTED | 31 | | | | | | |
| (5) RIGHT (6) ALL (LYING ON SEAT) (8) EXTERNAL TO PASSENGER COMPARTMENT | | (03) HOSPITALIZED FOR OBSERVATION LESS THAN 24 HOURS (04) HOSPITALIZED OVER 24 HOURS OR FOR SIGNIFICANT TREATMENT | | | | | | | |
| (9) UNKNOWN | | (05) FATAL, DEAD AT SCENE (06) FATAL, DOA (07) FATAL, DEAD WITHIN 24 HOURS | | | | | | | |
| POSTURE | , , | (08) FATAL, DEAD 24 HOURS TO 31 DAYS LATER | | | | | | | |
| (10) SITTING ON SEAT (11) SITTING ON SEAT IN ABNORMAL POSITION (E.G. FEET ON DASH, SIDEWAYS) | 7 0 | (09) FATAL, DEAD 31 DAYS TO 1 YEAR LATER (10) FATAL DEAD WITHIN UNKNOWN PERIOD | | | | | | | |
| (12) SITTING ON CONSOLE (20) ON LAP OR IN ARMS (30) STANDING ON SEAT | | (99) UNKNOWN INJURY SEVERITY SCORE (ISS) | | | | | | | |
| (40) STANDING ON FLOOR (47) STANDING, EXTERNAL TO PASSENGER COMPARTMENT | | (99) UNKNOWN | 0 | | | | | | |
| (50) IN BASSINET (60) IN CHILD SEAT | , | NON-IMPACT MED. CONDITIONS | 33 | | | | | | |
| (65) IN CHILD HARNESS (70) LYING ON SEAT (80) LYING/SITTING ON PASSENGER FLOOR | | (0) NONE (1) YES, TIME & TYPE UNKNOWN (2) PRE-CRASH FATAL (CLINICAL | <u>8</u> | | | | | | |
| (83) LYING/SITTING ON OTHER OBJECT IN PASSENGER | | DEATH AT WHEEL) (3) PRE-CRASH NON-FATAL (E.G. PRIOR INJURY, STROKE) | | | | | | | |
| COMPARTMENT: | | (4) PREGNANT (5) POST-CRASH FATAL (DROWNING) | | | | | | | |
| SEAT-BACK (87) LYING/SITTING, EXTERNAL TO PASSENGER COMPARTMENT | | (6) POST-CRASH NON-FATAL INJURY (7) OTHER: | | | | | | | |
| (97) OTHER: | | (CIRCLE EACH) (9) UNKNOWN | | | | | | | |

| · | | Occupant Information | OC-2 |
|---|----------|--|----------------|
| MEDICAL CONDITIONS (CONT.) | | CHILD SEAT TYPE | ! |
| POLICE INJURY SEVERITY CODE FOR THIS OCCUPANT (0) 0 - NO INJURY (1) C - POSSIBLE INJURY (2) B - NON-INCAPACITATING (3) A - INCAPACITATING INJURY (4) K - FATAL (5) INJURED, SEVERITY UNKNOWN (6) DIED PRIOR TO IMPACT (7) NON-FATAL INJURY, SEVERITY UNKNOWN (9) UNKNOWN | / ** | (00) NONE USED (01) YES, USED (02) INTEGRAL, Chrysler Mini-van (88) NOT APPLICABLE (ADULT OR OLDER CHILD) (99) UNKNOWN CHILD SEAT MAKE/MODEL | <u>\$</u> |
| RESTRAINT SYSTEM | | | |
| ACTIVE RESTRAINT SYSTEM (0) NONE (1) LAP BELT (2) SHOULDER HARNESS ONLY (3) BOTH LAP BELT & SHOULDER HARNESS (9) UNKNOWN ACTIVE RESTRAINT SYSTEM USAGE | 3 57 | EJECTION DEGREE OF EJECTION (0) NONE (1) PARTIAL (2) COMPLETE (7) EJECTED, DEGREE UNKNOWN (9) UNKNOWN IF EJECTED | Q _a |
| (0) NONE (AVAILABLE BUT NOT USED) (1) LAP BELT ONLY (2) SHOULDER HARNESS ONLY (3) BOTH LAP BELT & SHOULDER HARNESS (7) IMPROPER USAGE (8) NOT APPLICABLE (NONE AVAILABLE) (9) UNKNOWN | 30 | AREA OF EJECTION (01) WINDOW, LEFT SIDE (02) WINDOW, RIGHT SIDE (03) WINDOW, REAR (04) DOOR, LEFT SIDE (05) DOOR, RIGHT SIDE (06) DOOR, REAR OR TAILGATE (07) WINDSHIELD | 9 8 |
| PASSIVE RESTRAINT SYSTEM (0) NONE (1) AIR BAG INSTALLED (2) PASSIVE UPPER TORSO WITH KNEE BOLSTERS (3) PASSIVE UPPER TORSO WITHOUT KNEE BOLSTERS (4) PASSIVE LAP & UPPER TORSO (5) AIR BAG INSTALLED & PASSIVE RESTRAINT (7) OTHER: (9) UNKNOWN | <u>O</u> | (08) ROOF OR OPEN CONVERTIBLE OR FROM EXTERNAL AREA (96) EJECTED AREA UNKNOWN (97) OTHER AREA: (98) NOT APPLICABLE (NOT EJECTED) (99) UNKNOWN IF EJECTED IF OCCUPANT WAS EJECTED, DESCRIBE IN DETAIL BELOW: | |
| PASSIVE RESTRAINT SYSTEM USAGE (0) SYSTEM DEFEATED (1) AIR BAG NOT DEPLOYED (2) AIR BAG DEPLOYED | 8 | | . |
| (3) AIR BAG NOT REINSTALLED (4) PASSIVE UPPER TORSO USED (5) PASSIVE LAP & UPPER TORSO USED (6) SYSTEM USED IN MANUAL MODE (7) IMPROPER USAGE (8) NOT APPLICABLE (NOT ORIGINALLY EQUIPPED) (9) UNKNOWN | 40 | HEAD RESTRAINT AVAILABLE FOR THIS POSITION (0) NOT EQUIPPED OR REMOVED (1) EQUIPPED (9) UNKNOWN | |

| | | OCCUPANT INFORMATION | OC-3 |
|--|----------|---|------|
| OCCUPANT EYEWEAR (0) NONE (1) GLASSES (2) CONTACTS (3) BOTH GLASSES AND CONTACTS (4) OTHER (8) NOT APPLICABLE (9) UNKNOWN | <u>O</u> | SOURCE OF INFORMATION INTERVIEW (1) HOSPITAL (2) AUTOPSY (3) POLICE (4) OTHER (5) LAY CORONER/EXTERNAL EXAM (7) COMBINATION OF ABOVE (CIRCLE) (8) NOT APPLICABLE (9) UNKNOWN | 748 |

INDICATE LOCATION OF INJURIES.

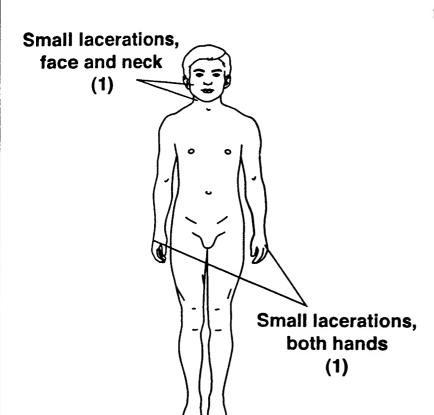

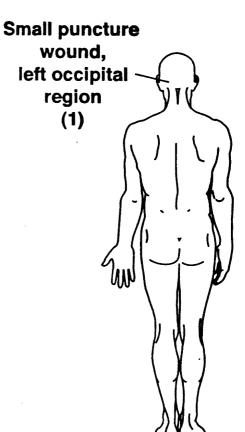

Duplicate columns 1-8 from the previous card.

Module <u>I</u> <u>C</u> Format <u>0</u> <u>1</u> 12

INJURY CLASSIFICATION IC-1

NOTE: Each line in the table below is a separate record (card).

Duplicate columns 1 - 12 for each completed line.

OCCUPANT INJURY CLASSIFICATION

| | | | | | | PRIM | ARY (| OIC | | A | ssoc | IATE | OIC | | СОММЕ | NTS |
|--------------------------------|----------|--|---------------|----------|----------|---------------|-------------|---------------|----------|----------|---------------|-------------|-----|----|-------|-----|
| OCCUPANT NUMBER | INJURY N | PLACE CONTACTS IN ORDER OF PROBABILITY (HORIZONTALLY). START WITH MOST PROBABLE IN 1ST CONTACT AREA COLUMN. AREA(S) OF POSSIBLE CONTACT 1ST 2ND | BODY REGION 1 | ASPECT N | LESION 3 | SYSTEMORGAN 4 | SEVERITY 15 | BODY REGION 1 | ASPECT Q | LESION 3 | SYSTEMORGAN 4 | SEVERITY 15 | | | | |
| 13-14 | 15-16 | 17-18 | 19-20 | COMMENTS | 21 | 22 | 23 | 24 | 25 | 26 | 27 | 28 | 29 | 30 | | |
| 03 | 01 | <u>5</u> 2 | | | Н | 2 | P | I | 1 | _ | _ | | | _ | | |
| 1 | 02 | 52 | | | E | W | <u></u> | I | 1 | _ | _ | | _ | | | |
| | 03 | <u>52</u> | | | N | A | <u>L</u> | <u>I</u> | 1 | | | _ | _ | | | |
| | 04 | <u>52</u> | | | W | <u>L</u> | <u>L</u> | I | 1 | _ | _ | _ | | _ | | |
| | 05 | <u>52</u> | | | W | r | <u>L</u> | Į | 1 | _ | _ | _ | _ | _ | | |
| | | | | | - | | | _ | _ | _ | | _ | | _ | | |
| | | | | | _ | _ | | _ | | _ | _ | _ | | _ | | |
| gi | | | | | - | _ | _ | _ | | _ | _ | _ | | _ | | |
| 7 88 Ch | | | | | _ | | _ | | _ | | _ | | _ | - | | |
| | | | | | - | _ | | | | _ | | _ | _ | - | | |
| Occupant Number' for each line | | | | | - | _ | _ | | _ | | | | _ | - | | |
| Š est | | | | | _ | _ | | _ | - | _ | _ | _ | | - | | |
| 2 | | | | | _ | _ | _ | _ | - | | _ | | _ | - | | |
| | | | | | _ | _ | | _ | - | _ | _ | | _ | - | | |
| | | | | | _ | _ | - | | - | _ | | _ | _ | - | | |
| | | | | | _ | | | _ | - | _ | _ | _ | _ | _ | | |
| | | | | | _ | | _ | _ | - | _ | _ | | _ | - | | |
| | | . | | | _ | _ | _ | | _ | | _ | | | | | |

CODES FOR AREAS OF POSSIBLE OCCUPANT CONTACT

| FRONT OF PASSENGER COMPARTMENT SIDES | | | |
|--------------------------------------|--|--------------|---|
| (10 | SUNVISOR, FITTING(S) WOR TOP MOLDING | 3iDES (20 | A SUBSACS OF CIDS INTERIOR |
| (1) | | (19 | |
| | | (13 | , and the second second |
| (0: | | (24 | |
| (54 | | \- ·, | , common |
| (5) | | (22) |) WINDOW GLASS (SIDE) |
| (50 | | (21) | WINDOW FRAMES (SIDE) |
| (81 | | | (5.52) |
| (02 | | (26) | ROOF SIDE RAIL |
| (47 | AIRBAG (ACRS) COMPARTMENT DOOR/COVER | (14) | A-PILLAR |
| (57 |) BENEATH INSTRUMENT PANEL | (15) | B-PILLAR |
| (53 | , | (16) | C-PILLAR |
| (48 | • | (17) | D-PILLAR |
| (86 | • | F | |
| · | , | FLOOR | |
| (28 |) FOOT CONTROLS (INCL. PARKING BRAKE PEDAL) | (40) | |
| | · | (44) | CONSOLE ON FLOOR OR BETWEEN SEATS |
| (09 |) STEERING ASSEMBLY (SPECIFIC AREA UNKNOWN) | | |
| (65 | STEERING WHEEL | (28) | PARKING BRAKE HANDLE ON FLOOR OR CONSOLE |
| (66 | | (91) | FOOT CONTROLS (INCL. PARKING BRAKE PEDAL) KICKPANEL |
| (59) | TRANSMISSION LEVER ON COLUMN | (-,) | MAIN PARE |
| (00) | LIADDWADE FETA (COECUMA | Roof | |
| (03) | | (25) | ROOF OR CONVERTIBLE TOP |
| (82) (83) | | (10) | SUNVISOR, FITTING(S) &/OR TOP MOLDING |
| (84) | | (26) | ROOF SIDE RAIL |
| (67) | | (24) | COAT HOOK |
| (06) | · · · · · · · · · · · · · · · · · · · | (18) | |
| (04) | | (39) | |
| (01) | | (68) | ROOF MOUNTED CONTROLS/CONSOLE |
| (08) | RADIO (BUILT IN) | (69) | ROLL BAR |
| (58) | • | F | • |
| (68) | | EXTERIO | OR SURFACE OF CASE VEHICLE |
| | The second of th | (37) | OUTSIDE SURFACE OF CASE VEHICLE |
| REAR | | (00) | (SPECIFIC AREA UNKNOWN) |
| (88) | SURFACE OF REAR INTERIOR | (35) | HOOD OF CASE VEHICLE |
| (23) | REAR WINDOW | (60) | EXTERIOR OF CASE VEHICLE (E.G. |
| | REAR WINDOW HEADER | (62) | OUTSIDE MIRRORS, ANTENNA, TRIM) |
| (50) | REAR SEAT CUSHION & BACK | (63) | EXTERIOR SIDE ROOF RAIL OF CASE VEHICLE |
| 1 | - 0 | (64) | TRUNK LID OF CASE VEHICLE TIRES OF CASE VEHICLE |
| | R-GENERAL | ν., | TIMES OF CASE VEHICLE |
| (11) | TRANSMISSION SELECTION LEVER (LOCATION UNK.) | BEYOND | CASE VEHICLE BOUNDARY |
| (59) | | (36) | AREA EXTERIOR TO CAR (SPECIFIC AREA UNK.) |
| (44) | | (70) | HOOD OF OTHER VEHICLE |
| (07) | PARKING BRAKE HANDLE (LOCATION UNKNOWN) | (71) | OTHER VEHICLE EXTERIOR HARDWARE (E.G. |
| (84) (85) | | • • | OUTSIDE MIRRORS, ANTENNA, TRIM) |
| (28) | PARKING BRAKE HANDLE ON FLOOR OR CONSOLE | (73) | EXTERIOR SIDE ROOF RAIL OF OTHER VEHICLE |
| (20) | FOOT CONTROLS (INCL. PARKING BRAKE PEDAL) | (74) | HEADLIGHT OR FRONT GRILL OF OTHER VEH. |
| (29) | FRONT SEAT-BACK/S) | (75) | TRUNK OF OTHER VEHICLE |
| | FRONT SEAT CUSHION | (76) | OUTSIDE SURFACE OF OTHER VEHICLE |
| | REAR SEAT CUSHION & BACK | (77) | TIRES OF OTHER VEHICLE |
| | ARMREST ON SEAT | (78) | GROUND |
| | UNDER SEAT BOTTOM | (79) | WATER |
| | | (80) | EXTERIOR OBJECT (NOT VEHICLE, GROUND, |
| (33) | RESTRAINT SYSTEM HARDWARE | | OR WATER. PLEASE DESCRIBE.) |
| (34) | RESTRAINT SYSTEM WEBBING | Drum | |
| (87) | AIR CUSHION SKIN (AIRBAG) | FENEIH | ATING OBJECTS |
| (47) | AIRBAG (ACRS) COMPARTMENT DOOR/COVER | (01) | OTHER VEHICLE |
| (46) | AIRBAG GAS | (72) | OBJECTS (DESCRIBE) |
| | KNEE RESTRAINT | MISCELL | ANFO: IS |
| | HEAD RESTRAINT | | NO CONTACT (INVALID FIELD FORM CODE) |
| | CHILD SEAT RESTRAINTS | (38) | OTHER (E.G. FIRE. DESCRIBE) |
| | CHILD SEAT | (90) | SPARE TIRE |
| | INTERIOR LOOSE OBJECT | i | INDUCED |
| | OTHER OCCUPANT(S) | | EJECTED, UNKNOWN CONTACT |
| (JE) (A1) | INTERNAL FLYING GLASS (FROM ANY SOURCE) UNKNOWN INTERIOR SURFACE | (98) | IMPACT FORCE, "WHIPLASH", |
| (*1) | A IN PURCH COULACE | | HYPEREXTENSION/COMPRESSION |
| | | (99) | UNKNOWN AREA OF CONTACT |
| | | | |

































16900#1













6900#22





























6900#3



















16900#4

































18900 #8















